



EmapSite

Masdar House, 1 Reading Road,
Eversley, RG27 0RP

Report Reference: EMS-482678_647814

Your Reference: EMS_482678_647814

Report Date 7 Jun 2018

Report Delivery Method: Email - pdf

Geo Insight

Address: The Promised Land Farm, Wendlebury Road, Bicester,

Dear Sir/ Madam,

Thank you for placing your order with Groundsure. Please find enclosed the **Groundsure Geo Insight** as requested.

If you would like further assistance regarding this report then please contact the emapsite customer services team on 0118 9736883 quoting the above report reference number.

Yours faithfully,

emapsite customer services team

Enc.
Groundsure Geo Insight

Address: The Promised Land Farm, Wendlebury Road, Bicester,
Date: 7 Jun 2018
Reference: EMS-482678_647814
Client: EmapSite

NW N NE



SW S SE

Aerial Photograph Capture date: 06-Sep-2015
Grid Reference: 457556,221013
Site Size: 15.35ha

Contents Page

Contents Page.....	3
Overview of Findings.....	5
1:10,000 Scale Availability.....	8
Availability of 1:10,000 Scale Geology Mapping.....	9
1 Geology (1:10,000 scale).....	10
1.1 Artificial Ground map (1:10,000 scale).....	10
1. Geology 1:10,000 scale.....	11
1.1 Artificial Ground.....	11
1.2 Superficial Deposits and Landslips map (1:10,000 scale).....	12
1.2 Superficial Deposits and Landslips.....	13
1.2.1 Superficial Deposits/ Drift Geology.....	13
1.2.2 Landslip.....	13
1.3 Bedrock and linear features map (1:10,000 scale).....	14
1.3 Bedrock and linear features.....	15
1.3.1 Bedrock/ Solid Geology.....	15
1.3.2 Linear features.....	15
2 Geology 1:50,000 Scale.....	16
2.1 Artificial Ground map.....	16
2. Geology 1:50,000 scale.....	17
2.1 Artificial Ground.....	17
2.1.1 Artificial/ Made Ground.....	17
2.1.2 Permeability of Artificial Ground.....	17
2.2 Superficial Deposits and Landslips map (1:50,000 scale).....	18
2.2 Superficial Deposits and Landslips.....	19
2.2.1 Superficial Deposits/ Drift Geology.....	19
2.2.2 Permeability of Superficial Ground.....	19
2.2.3 Landslip.....	19
2.2.4 Landslip Permeability.....	19
2.3 Bedrock and linear features map (1:50,000 scale).....	20
2.3 Bedrock, Solid Geology & linear features.....	21
2.3.1 Bedrock/Solid Geology.....	21
2.3.2 Permeability of Bedrock Ground.....	21
2.3.3 Linear features.....	21
3 Radon Data.....	22
3.1 Radon Affected Areas.....	22
3.2 Radon Protection.....	22
4 Ground Workings map.....	23
4 Ground Workings.....	24
4.1 Historical Surface Ground Working Features derived from Historical Mapping.....	24
4.2 Historical Underground Working Features derived from Historical Mapping.....	24
4.3 Current Ground Workings.....	25
5 Mining, Extraction & Natural Cavities.....	27
5.1 Historical Mining.....	27
5.2 Coal Mining.....	27
5.3 Johnson Poole and Bloomer.....	27
5.4 Non-Coal Mining.....	27
5.5 Non-Coal Mining Cavities.....	28
5.6 Natural Cavities.....	28
5.7 Brine Extraction.....	28
5.8 Gypsum Extraction.....	28
5.9 Tin Mining.....	28
5.10 Clay Mining.....	29
6 Natural Ground Subsidence.....	30
6.1 Shrink-Swell Clay map.....	30
6.2 Landslides map.....	31
6.3 Ground Dissolution of Soluble Rocks map.....	32
6.4 Compressible Deposits map.....	33
6.5 Collapsible Deposits map.....	34
6.6 Running Sand map.....	35

6 Natural Ground Subsidence.....	36
6.1 Shrink-Swell Clays.....	36
6.2 Landslides.....	37
6.3 Ground Dissolution of Soluble Rocks.....	37
6.4 Compressible Deposits.....	37
6.5 Collapsible Deposits.....	38
6.6 Running Sands.....	38
7 Borehole Records.....	40
8 Estimated Background Soil Chemistry.....	41
9 Railways and Tunnels map.....	42
9 Railways and Tunnels.....	43
9.1 Tunnels	43
9.2 Historical Railway and Tunnel Features	43
9.3 Historical Railways.....	44
9.4 Active Railways.....	44
9.5 Railway Projects.....	45

Overview of Findings

The Groundsure Geo Insight provides high quality geo-environmental information that allows geo-environmental professionals and their clients to make informed decisions and be forewarned of potential ground instability problems that may affect the ground investigation, foundation design and possibly remediation options that could lead to possible additional costs.

The report is based on the BGS 1:50,000 and 1:10,000 Digital Geological Map of Great Britain, BGS Geosure data; BRITPITS database; Non-coal mining data and Borehole Records, Coal Authority data including brine extraction areas, PBA non-coal mining and natural cavities database, Johnson Poole and Bloomer mining data and Groundsure's unique database including historical surface ground and underground workings.

For further details on each dataset, please refer to each individual section in the report as listed. Where the database has been searched a numerical result will be recorded. Where the database has not been searched '-' will be recorded.

Section 1: Geology 1:10,000 Scale

1.1 Artificial Ground	1.1 Is there any Artificial Ground/ Made Ground present beneath the study site at 1:10,000 scale?	No
1.2 Superficial Geology and Landslips	1.2.1 Is there any Superficial Ground/Drift Geology present beneath the study site at 1:10,000 scale?*	Yes
	1.2.2 Are there any records of landslip within 500m of the study site boundary at 1:10,000 scale?	No
1.3 Bedrock, Solid Geology and linear features	1.3.1 For records of Bedrock and Solid Geology beneath the study site* see the detailed findings section.	
	1.3.2 Are there any records of linear features within 500m of the study site boundary at 1:10,000 scale?	No

Section 2: Geology 1:50,000 Scale

2.1 Artificial Ground	2.1.1 Is there any Artificial Ground/ Made Ground present beneath the study site?	No
	2.1.2 Are there any records relating to permeability of artificial ground within the study site*boundary?	No
2.2 Superficial Geology and Landslips	2.2.1 Is there any Superficial Ground/Drift Geology present beneath the study site?*	Yes
	2.2.2 Are there any records of permeability of superficial ground within 500m of the study site?	Yes
	2.2.3 Are there any records of landslip within 500m of the study site boundary?	No
	2.2.4 Are there any records relating to permeability of landslips within the study site* boundary?	No

Section 2: Geology 1:50,000 Scale

2.3 Bedrock, Solid Geology and linear features

2.3.1 For records of Bedrock and Solid Geology beneath the study site* see the detailed findings section.

2.3.2 Are there any records relating to permeability of bedrock ground within the study site boundary?

Yes

2.3.3 Are there any records of linear features within 500m of the study site boundary?

No

Section 3: Radon

3. Radon

3.1 Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level?

The property is not in a Radon Affected Area, as less than 1% of properties are above the Action Level.

3.2 Radon Protection

No radon protective measures are necessary.

Section 4: Ground Workings


	On-site	0-50m	51-250	251-500	501-1000
4.1 Historical Surface Ground Working Features from Small Scale Mapping	0	2	10	Not Searched	Not Searched
4.2 Historical Underground Workings from Small Scale Mapping	0	0	0	0	0
4.3 Current Ground Workings	0	0	0	3	0

Section 5: Mining, Extraction & Natural Cavities

	On-site	0-50m	51-250	251-500	501-1000
5.1 Historical Mining	0	0	0	0	0
5.2 Coal Mining	0	0	0	0	0
5.3 Johnson Poole and Bloomer Mining Area	0	0	0	0	0
5.4 Non-Coal Mining*	0	0	0	0	0
5.5 Non-Coal Mining Cavities	0	0	0	0	0
5.5 Natural Cavities	0	0	0	0	0


Section 5: Mining, Extraction & Natural Cavities	On-site	0-50m	51-250	251-500	501-1000
5.6 Brine Extraction	0	0	0	0	0
5.7 Gypsum Extraction	0	0	0	0	0
5.8 Tin Mining	0	0	0	0	0
5.9 Clay Mining	0	0	0	0	0
Section 6: Natural Ground Subsidence	On-site				
6.1 Shrink-Swell Clay	Moderate				
6.2 Landslides	Very Low				
6.3 Ground Dissolution of Soluble Rocks	Negligible				
6.4 Compressible Deposits	Moderate				
6.5 Collapsible Deposits	Very Low				
6.5 Running Sand	Low				
Section 7: Borehole Records	On-site	0-50m	51-250		
7 BGS Recorded Boreholes	0	1	0		
Section 8: Estimated Background Soil Chemistry	On-site	0-50m	51-250		
8 Records of Background Soil Chemistry	13	2	0		
Section 9: Railways and Tunnels	On-site	0-50m	51-250	250-500	
9.1 Tunnels	0	0	0	Not Searched	
9.2 Historical Railway and Tunnel Features	0	0	7	Not Searched	
9.3 Historical Railways	0	0	0	Not Searched	
9.4 Active Railways	0	0	12	Not Searched	
9.5 Railway Projects	0	0	0	0	

1:10,000 Scale Availability

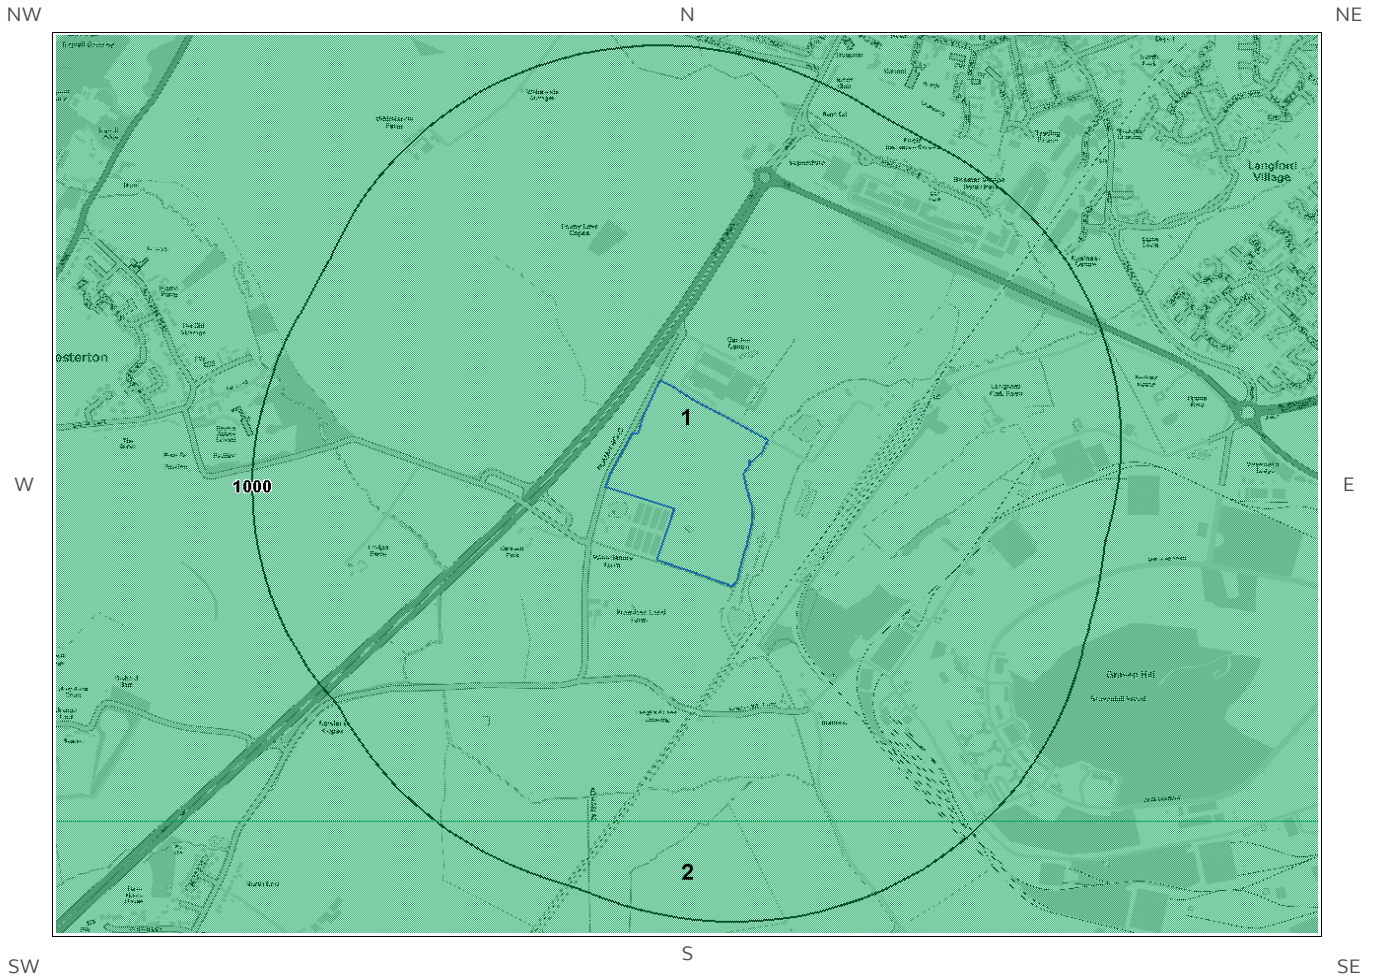

1_10,000 Availability Legend

© Crown copyright and database rights 2018.
Ordnance Survey license 100035207.

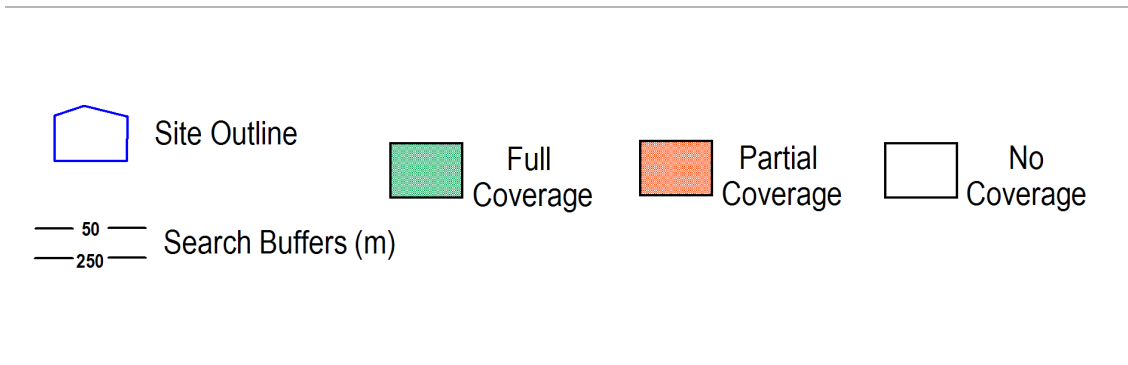

Availability of 1:10,000 Scale Geology Mapping

The following information represents the availability of the key components of the 1:10,000 scale geological data.

ID	Distance	Artificial Coverage	Superficial Coverage	Bedrock Coverage	Mass Movement Coverage
1	0.0	Some deposits are mapped	Full	Full	No coverage
2	700.0	Some deposits are mapped	Full	Full	No coverage


Guidance: The 1:10,000 scale geological interpretation is the most detailed generally available from BGS and is the scale at which most geological surveying is carried out in the field. The database is presented as four types of geology (artificial, mass movement, superficial and bedrock), although not all themes are mapped or available on every map sheet. Therefore a coverage layer showing the availability of the four themes is presented above.

The definitions of coverage are as follows:

Geology	Full Coverage	Partial Coverage	No Coverage
Bedrock	The whole tile has been mapped	Some but not all the tile has been mapped	No coverage
Superficial	The whole tile has been mapped	Some but not all of the tile has been mapped	No coverage
Artificial	Some deposits are mapped on this tile	-	No deposits are mapped
Mass Movement	Some deposits are mapped on this tile	-	No coverage






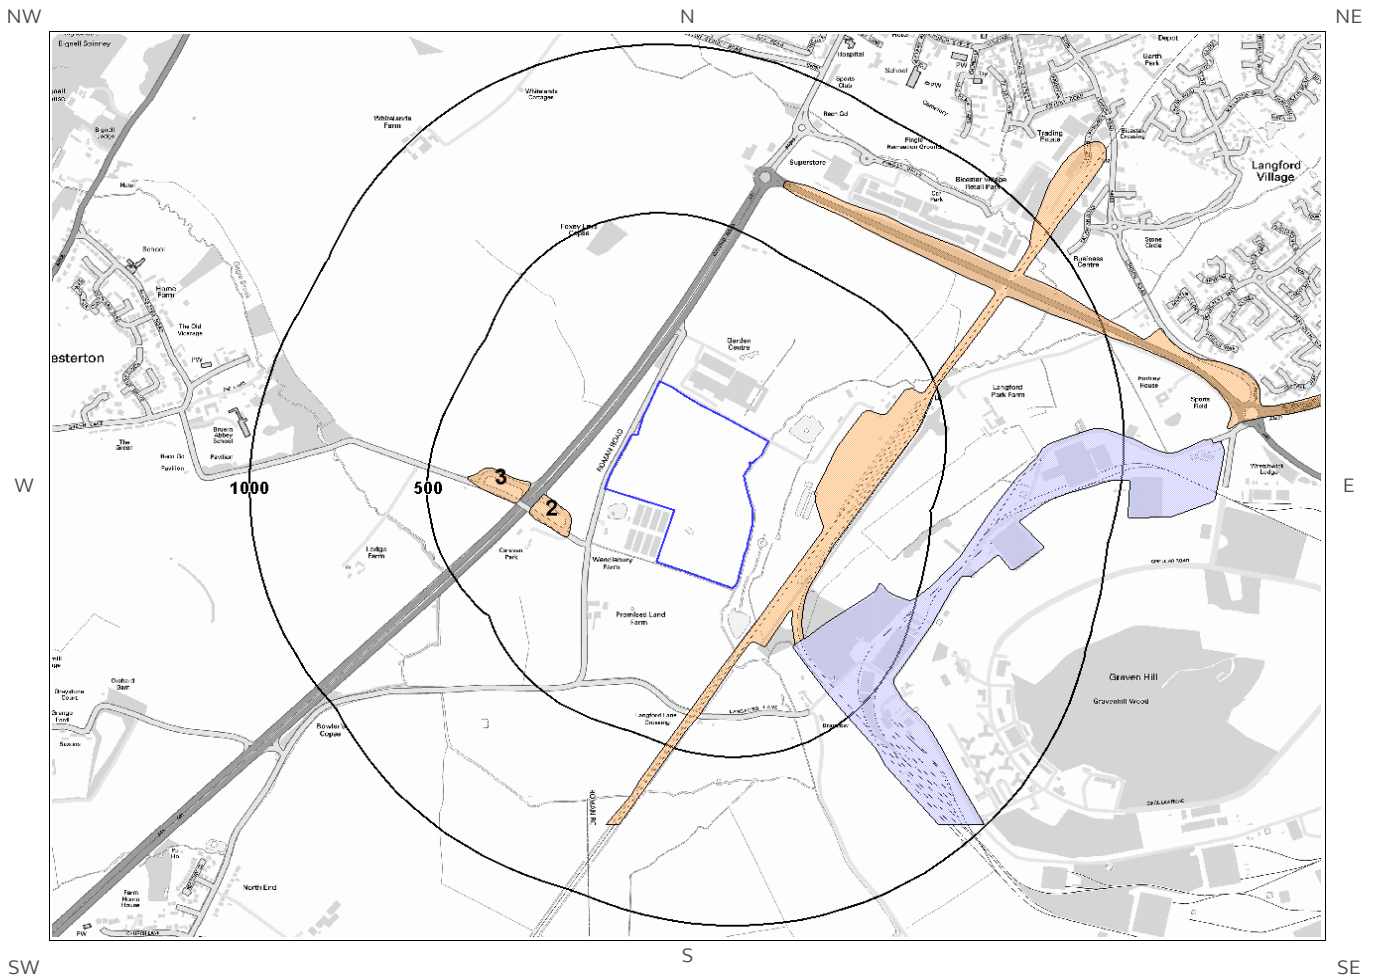


1 Geology (1:10,000 scale).

1.1 Artificial Ground map (1:10,000 scale)



Artificial Ground Legend

© Crown copyright and database rights 2018.
Ordnance Survey license 100035207.

	Site Outline		Made Ground (undivided)		Disturbed Ground (undivided)
	Search Buffers (m)		Worked Ground (undivided)		Landscaped Ground (undivided)
			Infilled Ground		Reclaimed Ground

1. Geology 1:10,000 scale


1.1 Artificial Ground

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping.

Are there any records of Artificial/ Made Ground within 500m of the study site boundary at 1:10,000 scale? Yes




ID	Distance	Direction	LEX Code	Description	Rock Description
1	108.0	SE	MGR-ARTDP	Made Ground (Undivided)	Artificial Deposit
2	125.0	SW	MGR-ARTDP	Made Ground (Undivided)	Artificial Deposit
3	210.0	W	MGR-ARTDP	Made Ground (Undivided)	Artificial Deposit
4	238.0	SE	LSGR- UNKNOWN	Landscaped Ground (Undivided)	Unknown/unclassified Entry

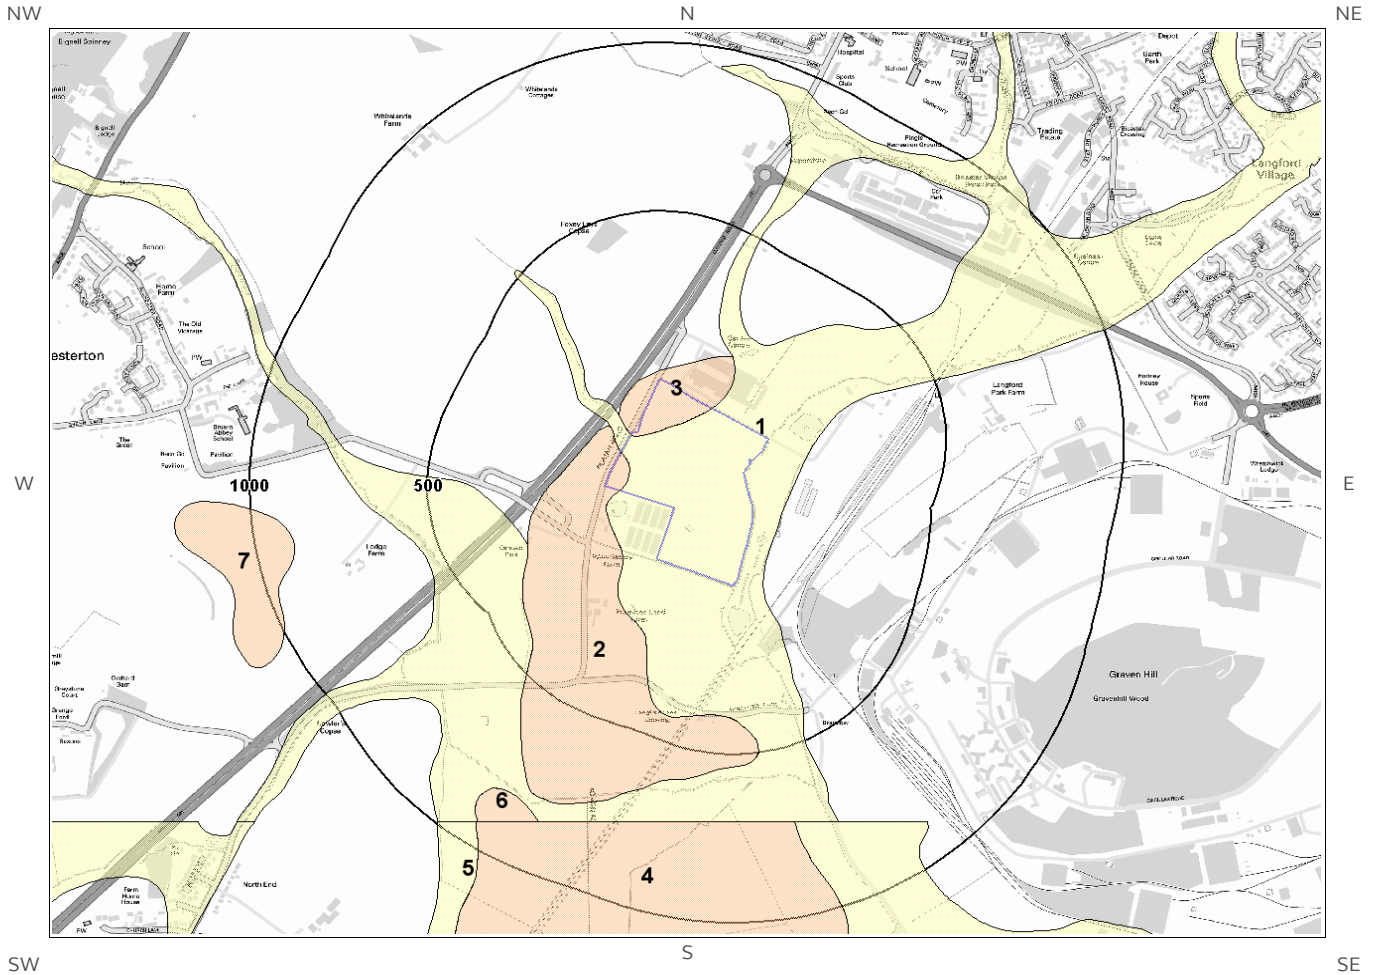1.2 Superficial Deposits and Landslips map (1:10,000 scale)



Artificial Ground Legend

© Crown copyright and database rights 2018.
Ordnance Survey license 100035207.

-  Site Outline
-  500
-  1000 Search Buffers (m)

1.2 Superficial Deposits and Landslips

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping

1.2.1 Superficial Deposits/ Drift Geology

Are there any records of Superficial Deposits/ Drift Geology within 500m of the study site boundary at 1:10,000 scale? Yes

ID	Distance (m)	Direction	LEX Code	Description	Rock Description
1	0.0	On Site	ALV-CSV	Alluvium - Sandy Gravelly Clay	Clay, Sandy, Gravelly
2	0.0	On Site	RTD1-XSV	River Terrace Deposits, 1 - Sand And Gravel	Sand And Gravel
3	0.0	On Site	RTD1-XSV	River Terrace Deposits, 1 - Sand And Gravel	Sand And Gravel

1.2.2 Landslip


Are there any records of Landslip within 500m of the study site boundary at 1:10,000 scale? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:10,000 scale




This Geology shows the main components as discrete layers, these are: Artificial / Made Ground, Superficial / Drift Geology and Landslips. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.

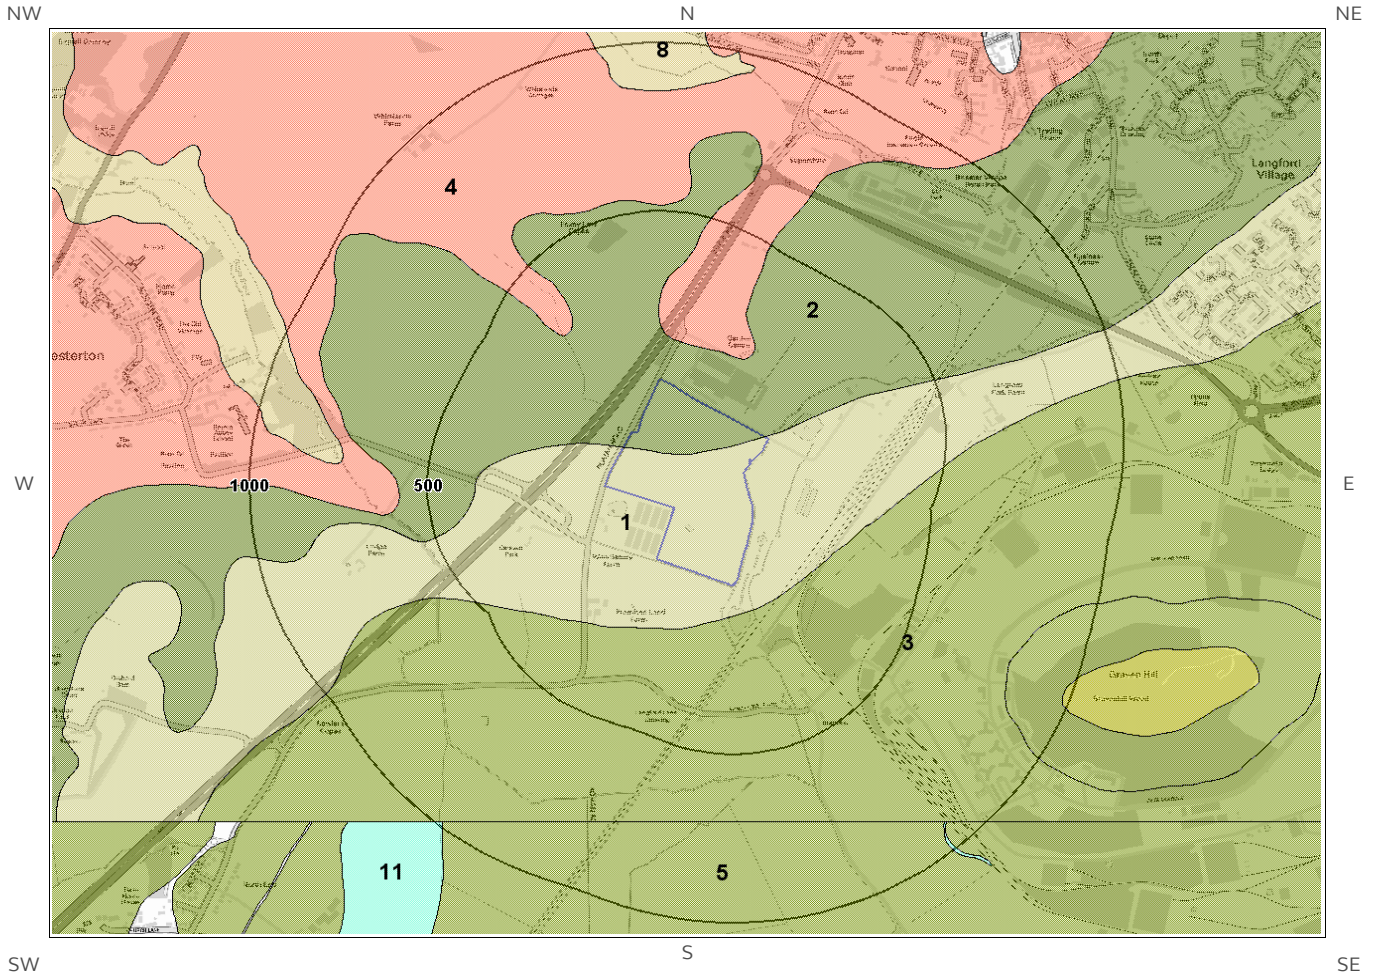1.3 Bedrock and linear features map (1:10,000 scale)



Bedrock and linear features Legend

© Crown copyright and database rights 2018.
Ordnance Survey license 100035207.

-  Site Outline
 -  500
 -  1000
- Search Buffers (m)

1.3 Bedrock and linear features

The following geological information represented on the mapping is derived from 1:10,000 scale BGS Geological mapping.

1.3.1 Bedrock/ Solid Geology

Records of Bedrock/Solid Geology within 500m of the study site boundary at 1:10,000 scale.

ID	Distance (m)	Direction	LEX Code	Description	Rock Age
1	0.0	On Site	KLS-SDSL	Kellaways Sand Member - Sandstone And Siltstone, Interbedded	Callovian Age
2	0.0	On Site	KLC-MDST	Kellaways Clay Member - Mudstone	Callovian Age
3	85.0	S	PET-MDST	Peterborough Member - Mudstone	Callovian Age
4	126.0	N	CB-LMST	Cornbrash Formation - Limestone	Callovian Age - Bathonian Age

1.3.2 Linear features

Are there any records of linear features within 500m of the study site boundary at 1:10,000 scale? No


Database searched and no data found at this scale.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of great Britain at 1:10,000 scale.


This Geology shows the main components as discrete layers, these are: Bedrock/ Solid Geology and linear features such as faults. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.

2 Geology 1:50,000 Scale

2.1 Artificial Ground map

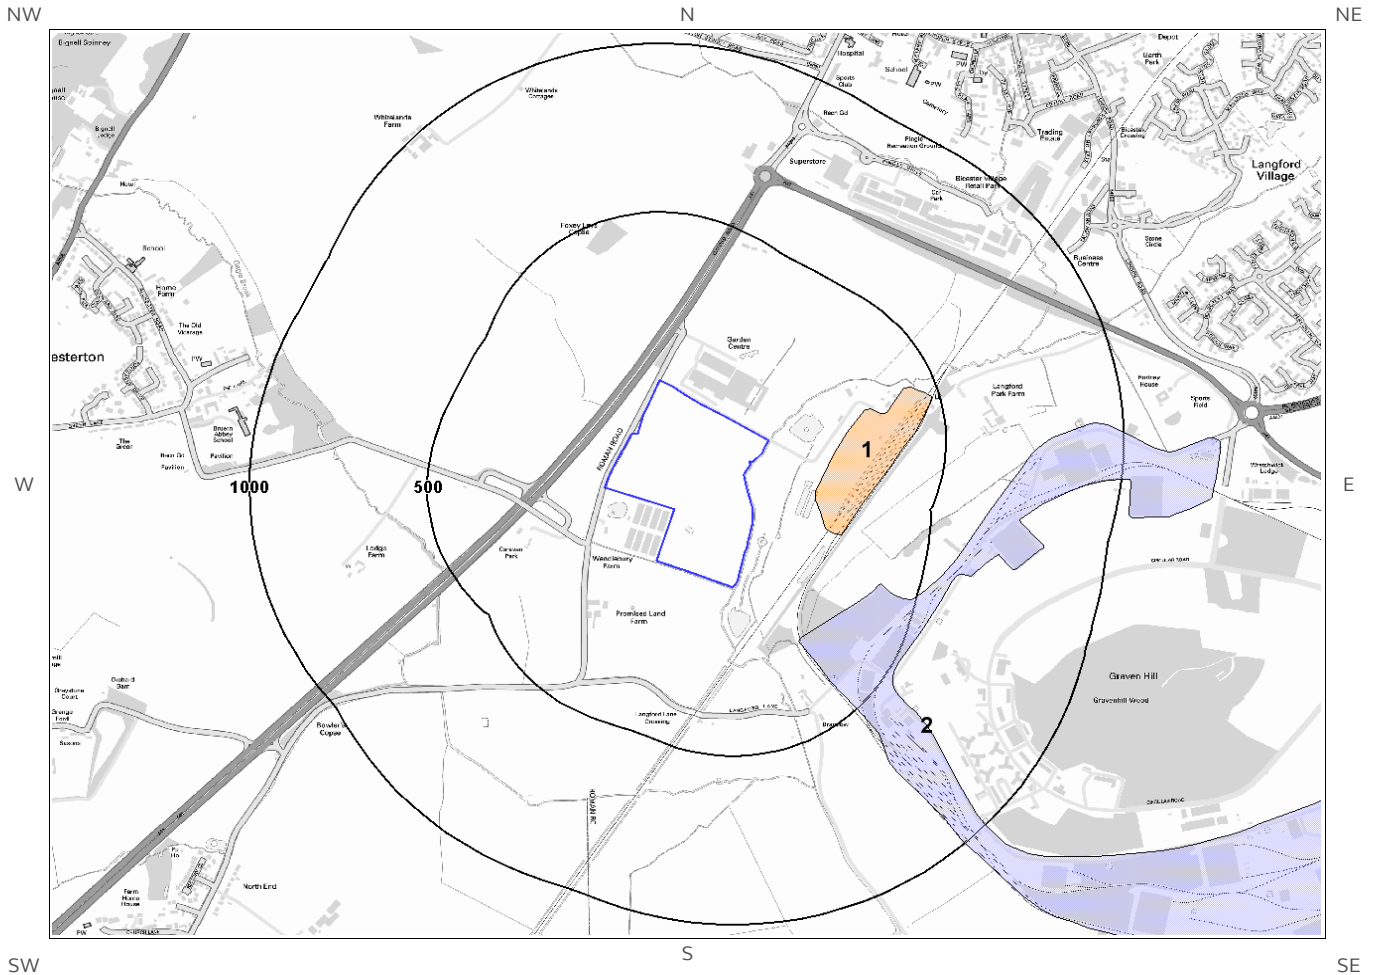

© Crown copyright and database rights 2018.
Ordnance Survey license 100035207.

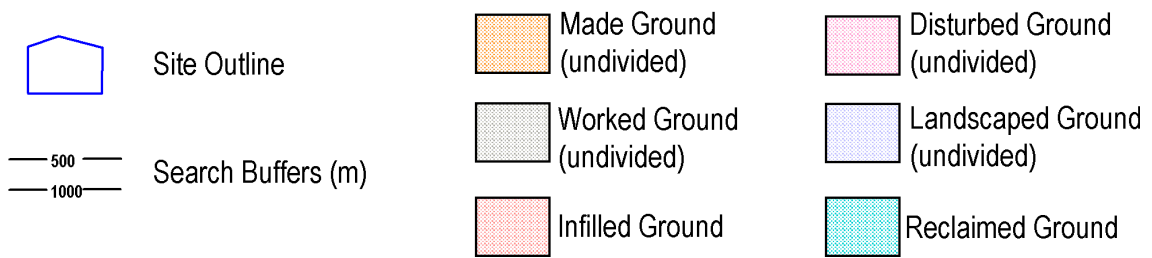

2. Geology 1:50,000 scale

2.1 Artificial Ground

The following geological information represented on the mapping is derived from 1:50,000 scale BGS Geological mapping, Sheet No: 219

2.1.1 Artificial/ Made Ground

Are there any records of Artificial/ Made Ground within 500m of the study site boundary? Yes


ID	Distance (m)	Direction	LEX Code	Description	Rock Description
1	179.0	E	MGR-ARTDP	MADE GROUND (UNDIVIDED)	ARTIFICIAL DEPOSIT
2	240.0	SE	LSGR-ARTGR	LANDSCAPED GROUND (UNDIVIDED)	ARTIFICIALLY MODIFIED GROUND

2.1.2 Permeability of Artificial Ground


Are there any records relating to permeability of artificial ground within the study site boundary? No

Database searched and no data found.

2.2 Superficial Deposits and Landslips map (1:50,000 scale)

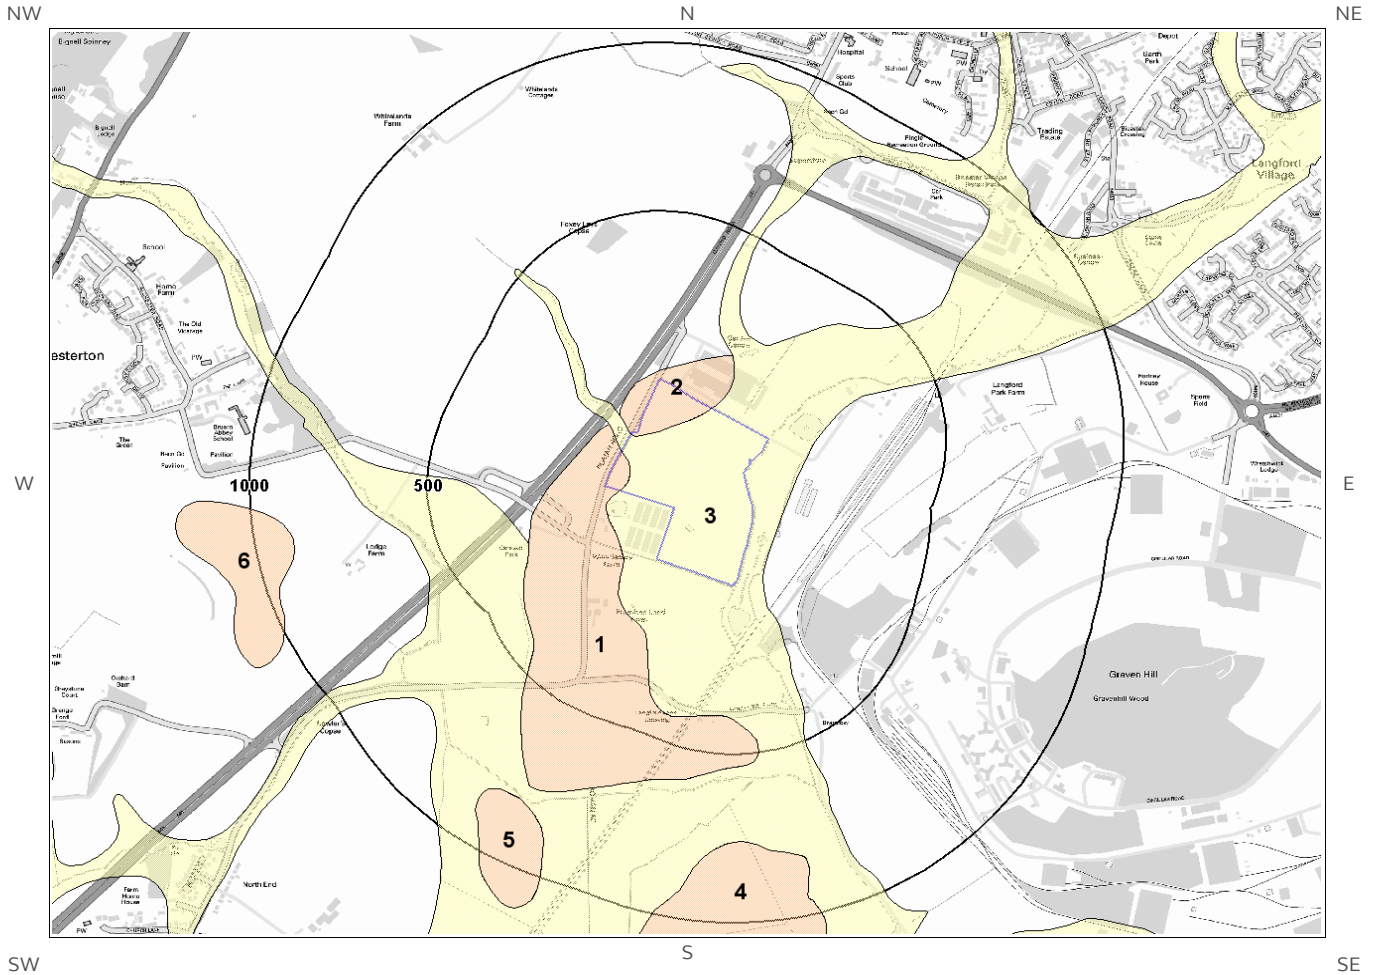

© Crown copyright and database rights 2018.
Ordnance Survey license 100035207.

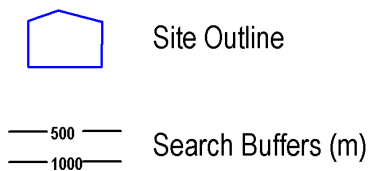

2.2 Superficial Deposits and Landslips

2.2.1 Superficial Deposits/ Drift Geology

Are there any records of Superficial Deposits/ Drift Geology within 500m of the study site boundary? Yes

ID	Distance	Direction	LEX Code	Description	Rock Description
1	0.0	On Site	RTD1-XSV	RIVER TERRACE DEPOSITS, 1	SAND AND GRAVEL
2	0.0	On Site	RTD1-XSV	RIVER TERRACE DEPOSITS, 1	SAND AND GRAVEL
3	0.0	On Site	ALV-XCZSV	ALLUVIUM	CLAY, SILT, SAND AND GRAVEL

2.2.2 Permeability of Superficial Ground

Are there any records relating to permeability of superficial ground within the study site boundary? Yes

Distance (m)	Direction	Flow Type	Maximum Permeability	Minimum Permeability
0.0	On Site	Intergranular	Very High	High
0.0	On Site	Intergranular	High	Very Low
0.0	On Site	Intergranular	Very High	High

2.2.3 Landslip

Are there any records of Landslip within 500m of the study site boundary? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:50,000 scale.


This Geology shows the main components as discrete layers, there are: Artificial/ Made Ground, Superficial/ Drift Geology and Landslips. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nationwide coverage.

2.2.4 Landslip Permeability

Are there any records relating to permeability of landslips within the study site boundary? No

Database searched and no data found.


2.3 Bedrock and linear features map (1:50,000 scale)

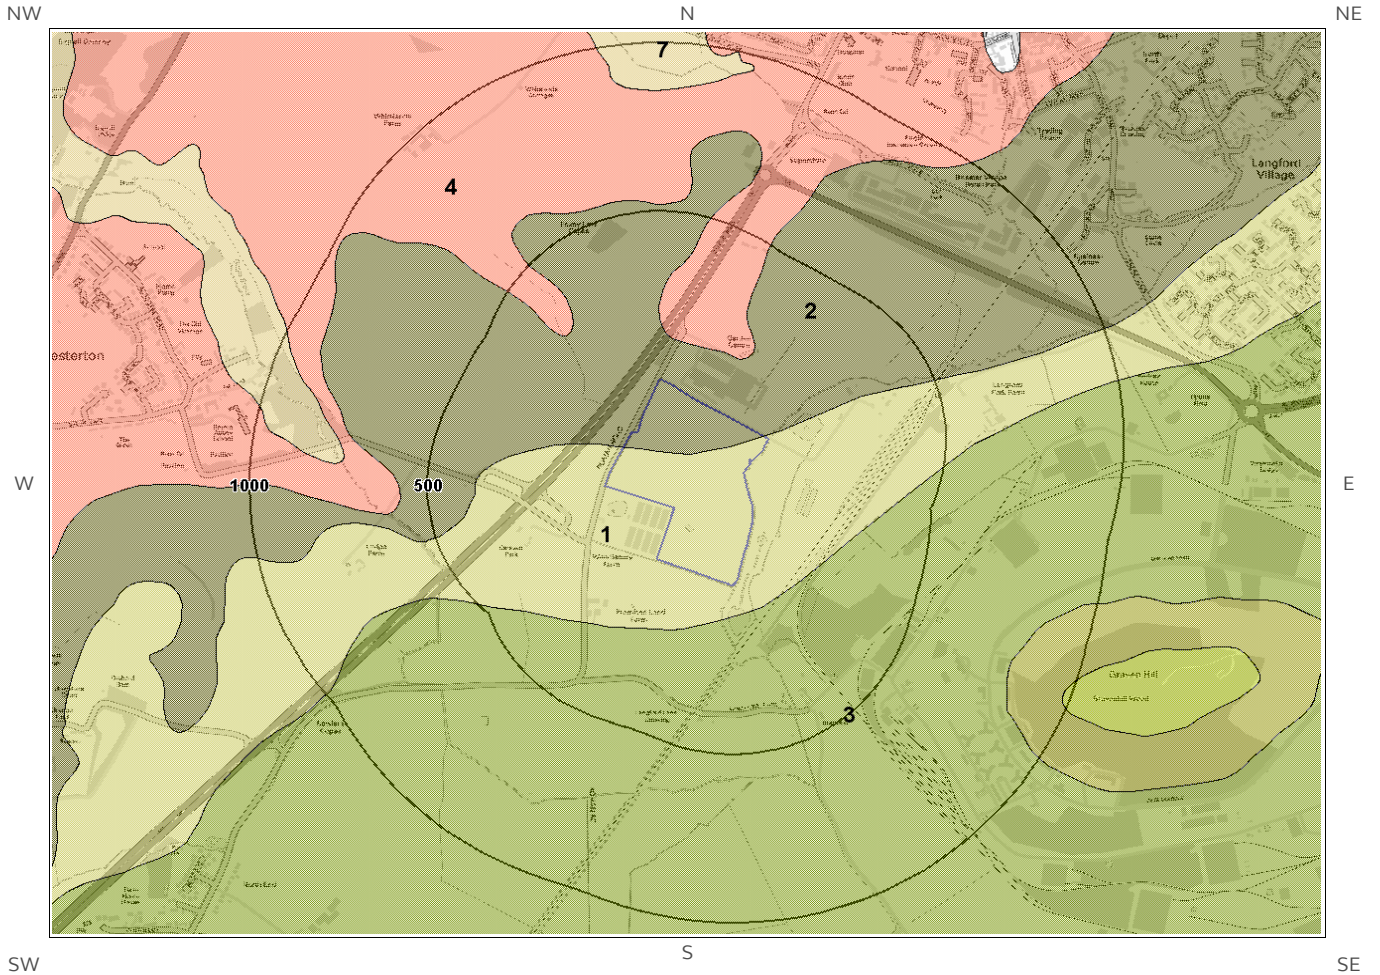

© Crown copyright and database rights 2018.
 Ordnance Survey license 100035207.



Site Outline



Search Buffers (m)

2.3 Bedrock, Solid Geology & linear features

The following geological information represented on the mapping is derived from 1:50,000 scale BGS Geological mapping, Sheet No: 219

2.3.1 Bedrock/Solid Geology

Records of Bedrock/Solid Geology within 500m of the study site boundary:

ID	Distance	Direction	LEX Code	Rock Description	Rock Age
1	0.0	On Site	KLS-SDSL	KELLAWAYS SAND MEMBER - SANDSTONE AND SILTSTONE, INTERBEDDED	CALLOVIAN
2	0.0	On Site	KLC-MDST	KELLAWAYS CLAY MEMBER - MUDSTONE	CALLOVIAN
3	87.0	S	PET-MDST	PETERBOROUGH MEMBER - MUDSTONE	CALLOVIAN
4	127.0	N	CB-LMST	CORNBRASH FORMATION - LIMESTONE	BATHONIAN

2.3.2 Permeability of Bedrock Ground

Are there any records relating to permeability of bedrock ground within the study site boundary? Yes

Distance	Direction	Flow Type	Maximum Permeability	Minimum Permeability
0.0	On Site	Mixed	Moderate	Moderate
0.0	On Site	Fracture	Low	Very Low

2.3.3 Linear features

Are there any records of linear features within 500m of the study site boundary? No

Database searched and no data found.

The geology map for the site and surrounding area are extracted from the BGS Digital Geological Map of Great Britain at 1:50,000 scale.

This Geology shows the main components as discrete layers, these are: Bedrock/Solid Geology and linear features such as faults. These are all displayed with the BGS Lexicon code for the rock unit and BGS sheet number. Not all of the main geological components have nation wide coverage.

3 Radon Data

3.1 Radon Affected Areas


Is the property in a Radon Affected Area as defined by the Health Protection Agency (HPA) and if so what percentage of homes are above the Action Level? The property is not in a Radon Affected Area, as less than 1% of properties are above the Action Level.

The radon data in this report is supplied by the BGS/Public Health England and is the definitive map of Radon Affected Areas in Great Britain and Northern Ireland. The dataset was created using long-term radon measurements in over 479,000 homes across Great Britain and 23,000 homes across Northern Ireland, combined with geological data. The dataset is considered accurate to 50m to allow for the margin of error in geological lines, and the findings of this report supercede any answer given in the less accurate Indicative Atlas of Radon in Great Britain, which simplifies the data to give the highest risk within any given 1km grid square. As such, the radon atlas is considered indicative, whereas the data given in this report is considered definitive.

3.2 Radon Protection






Is the property in an area where Radon Protection are required for new properties or extensions to existing ones as described in publication BR211 by the Building Research Establishment? No radon protective measures are necessary.

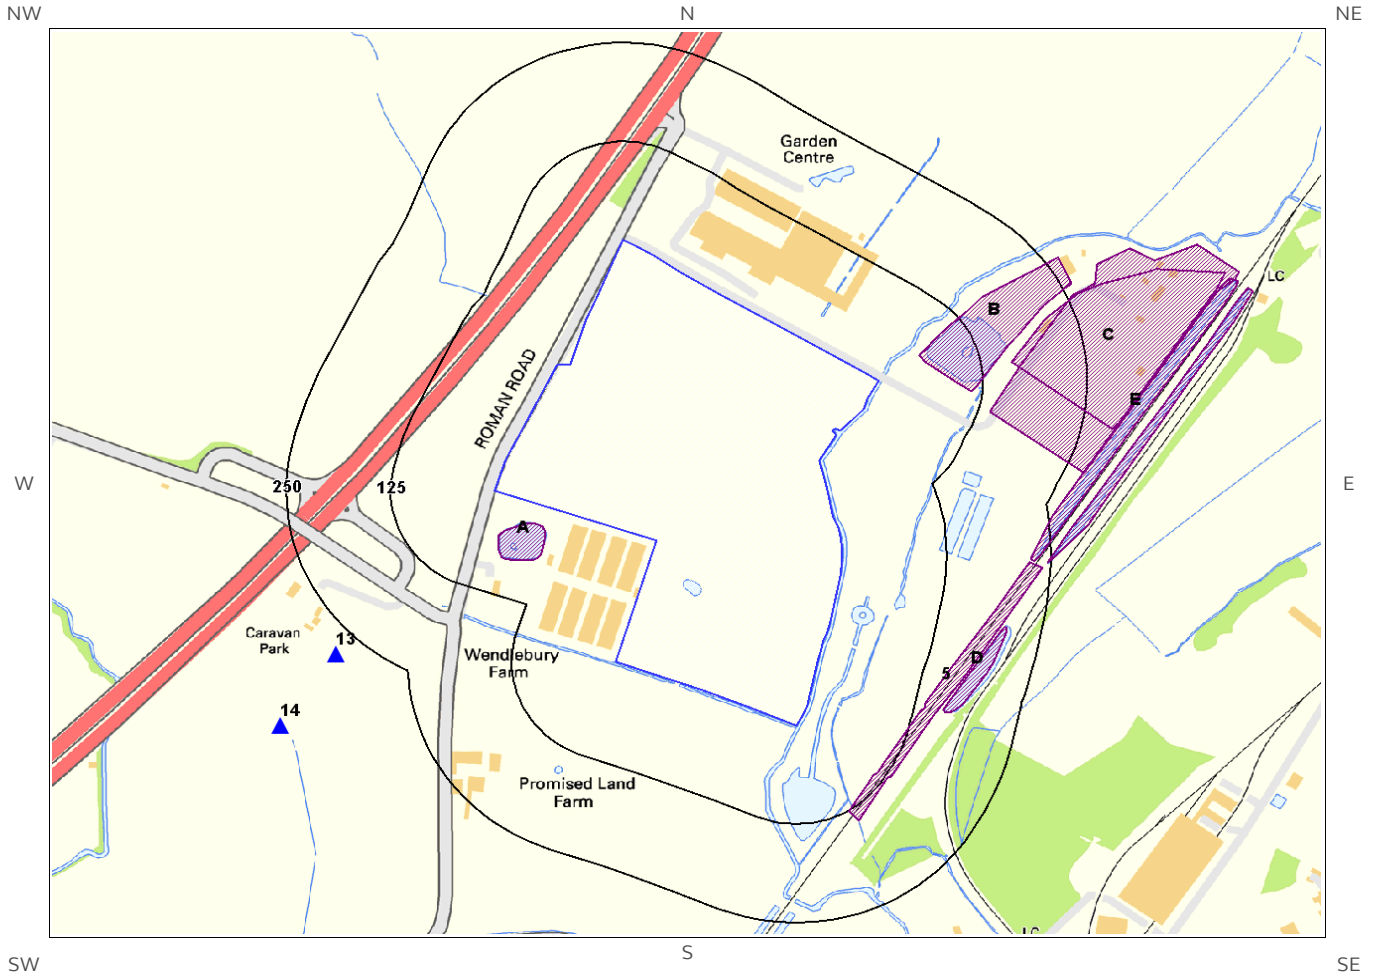4 Ground Workings map



Ground Workings Legend

© Crown copyright and database rights 2018.
Ordnance Survey license 100035207.

-  Site Outline
-  Historic Surface Ground Workings
-  Historic Underground Workings
-  Current Ground Workings
-  Search Buffers (m)

4 Ground Workings

4.1 Historical Surface Ground Working Features derived from Historical Mapping

This dataset is based on Groundsure's unique Historical Land Use Database derived from 1:10,560 and 1:10,000 scale historical mapping

Are there any Historical Surface Ground Working Features within 250m of the study site boundary? **Yes**

ID	Distance (m)	Direction	NGR	Use	Date
1A	24.0	S	457341 220932	Pond	1995
2A	24.0	S	457341 220932	Pond	1985
3B	59.0	NE	457909 221207	Ponds	1985
4B	59.0	NE	457909 221207	Ponds	1995
5	112.0	SE	457849 220743	Cuttings	1880
6C	139.0	E	458051 221163	Sewage Works	1995
7C	139.0	E	458051 221163	Sewage Works	1985
8D	160.0	E	457884 220770	Pond	1985
9D	160.0	E	457884 220770	Pond	1995
10C	162.0	E	458056 221176	Sewage Farm	1970
11E	226.0	E	458075 221086	Water Body	1880
12E	246.0	E	458093 221079	Pond	1880

4.2 Historical Underground Working Features derived from Historical Mapping

This data is derived from the Groundsure unique Historical Land Use Database. It contains data derived from 1:10,000 and 1:10,560 historical Ordnance Survey Mapping and includes some natural topographical features (Shake Holes for example) as well as manmade features that may have implications for ground stability. Underground and mining features have been identified from surface features such as shafts. The distance that these extend underground is not shown.

Are there any Historical Underground Working Features within 1000m of the study site boundary? **No**

Database searched and no data found.

4.3 Current Ground Workings


This dataset is derived from the BGS BRITPITS database covering active; inactive mines; quarries; oil wells; gas wells and mineral wharves; and rail deposits throughout the British Isles.

Are there any BGS Current Ground Workings within 1000m of the study site boundary? Yes

The following Current Ground Workings information is provided by British Geological Survey:


ID	Distance (m)	Direction	NGR	Commodity Produced	Pit Name	Type of working	Status
13	281.0	SW	457118 220789	Clay & Shale	Promised-land Farm	A surface mineral working. It may be termed Quarry, Sand Pit, Clay Pit or Opencast Coal Site	Ceased
14	393.0	SW	457051 220699	Clay & Shale	Promised-land Farm	A surface mineral working. It may be termed Quarry, Sand Pit, Clay Pit or Opencast Coal Site	Ceased
Not shown	397.0	SE	457965 220435	Limestone	Langford Lane Quarry	A surface mineral working. It may be termed Quarry, Sand Pit, Clay Pit or Opencast Coal Site	Ceased

5 Mining, Extraction & Natural Cavities map

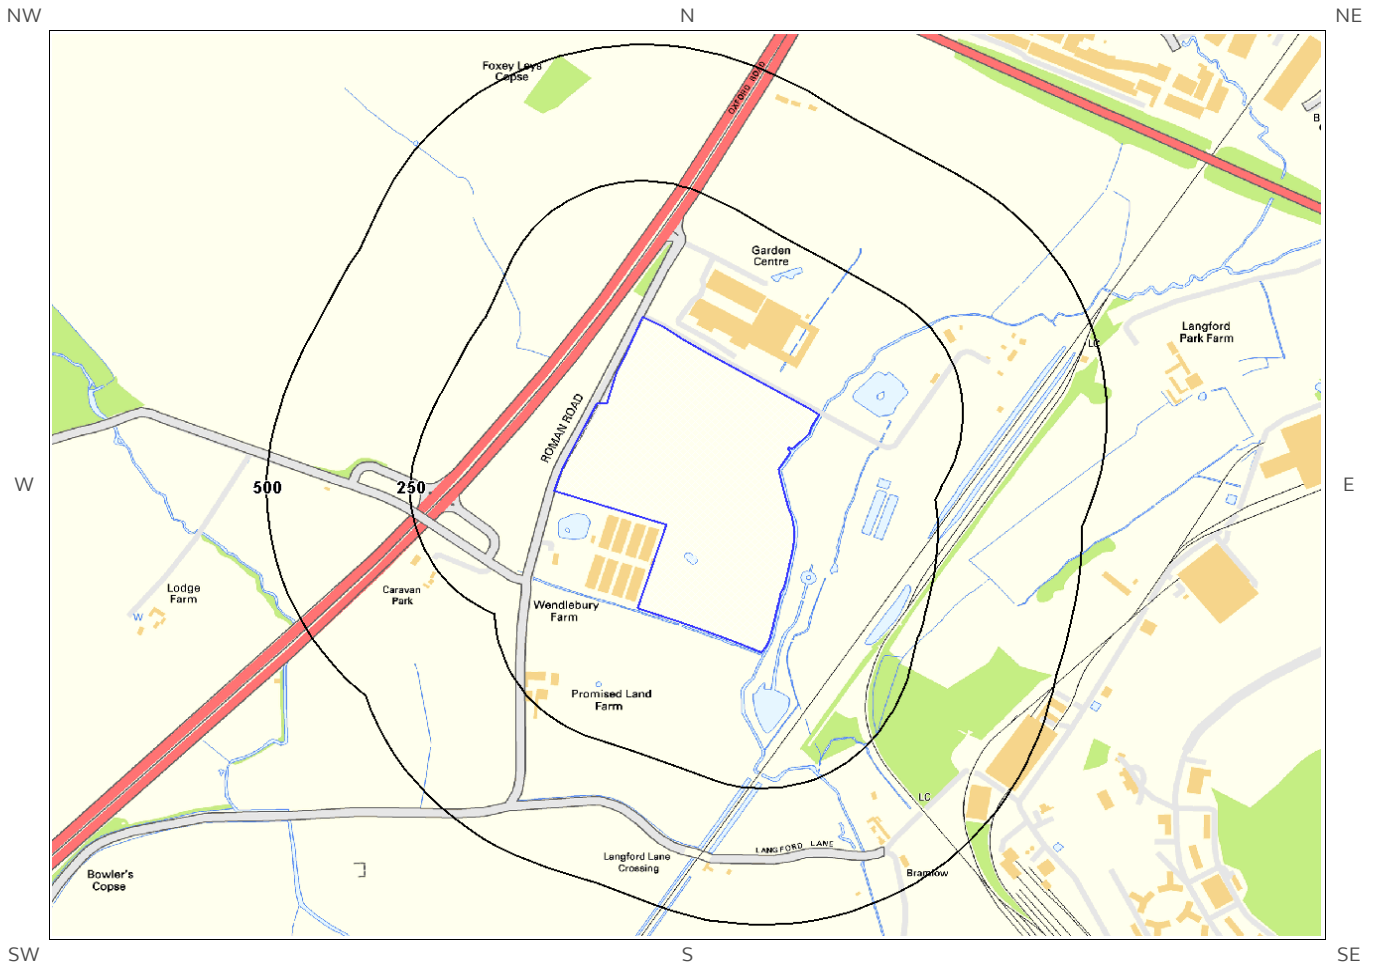

Mining, Extraction and Natural Cavities Legend

© Crown copyright and database rights 2018.
Ordnance Survey license 100035207.

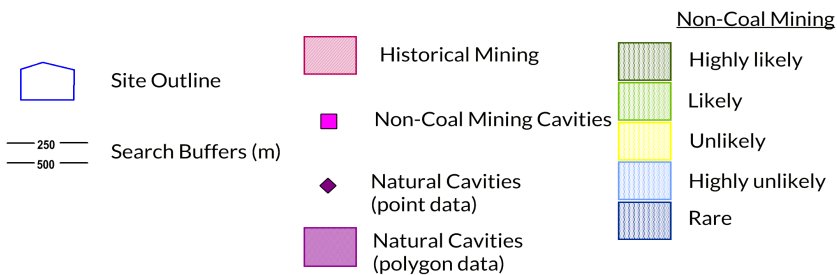

5 Mining, Extraction & Natural Cavities

5.1 Historical Mining

This dataset is derived from Groundsure unique Historical Land-use Database that are indicative of mining or extraction activities.

Are there any Historical Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.2 Coal Mining

This dataset provides information as to whether the study site lies within a known coal mining affected area as defined by the coal authority.

Are there any Coal Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.3 Johnson Poole and Bloomer

This dataset provides information as to whether the study site lies within an area where JPB hold information relating to mining.

Are there any JPB Mining areas within 1000m of the study site boundary? No

The following information provided by JPB is not represented on mapping: Database searched and no data found.

5.4 Non-Coal Mining

This dataset provides information as to whether the study site lies within an area which may have been subject to non-coal historic mining.

Are there any Non-Coal Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

5.5 Non-Coal Mining Cavities

This dataset provides information from the Peter Brett Associates (PBA) mining cavities database (compiled for the national study entitled “Review of mining instability in Great Britain, 1990” PBA has also continued adding to this database) on mineral extraction by mining.

Are there any Non-Coal Mining cavities within 1000m of the study site boundary? No

Database searched and no data found.

5.6 Natural Cavities

This dataset provides information based on the Peter Brett Associates natural cavities database. The dataset is made up of points and polygons. Where polygons are used these represent an area in which it is expected the cavities could be found. It does not indicate that cavities are present everywhere within the polygon, and caution should be used in the interpretation of this data.

Are there any Natural Cavities within 1000m of the study site boundary? No

Database searched and no data found.

5.7 Brine Extraction

This data provides information from the Coal Authority issued on behalf of the Cheshire Brine Subsidence Compensation Board.

Are there any Brine Extraction areas within 1000m of the study site boundary? No

Database searched and no data found.

5.8 Gypsum Extraction

This dataset provides information on Gypsum extraction from British Gypsum records.

Are there any Gypsum Extraction areas within 1000m of the study site boundary? No

Database searched and no data found.

5.9 Tin Mining

This dataset provides information on tin mining areas and is derived from tin mining records. This search is based upon postcode information to a sector level..

Are there any Tin Mining areas within 1000m of the study site boundary? No

Database searched and no data found.

This dataset provides information on Kaolin and Ball Clay mining from relevant mining records.


Are there any Clay Mining areas within 1000m of the study site boundary?

No

Database searched and no data found.

6 Natural Ground Subsidence

6.1 Shrink-Swell Clay map

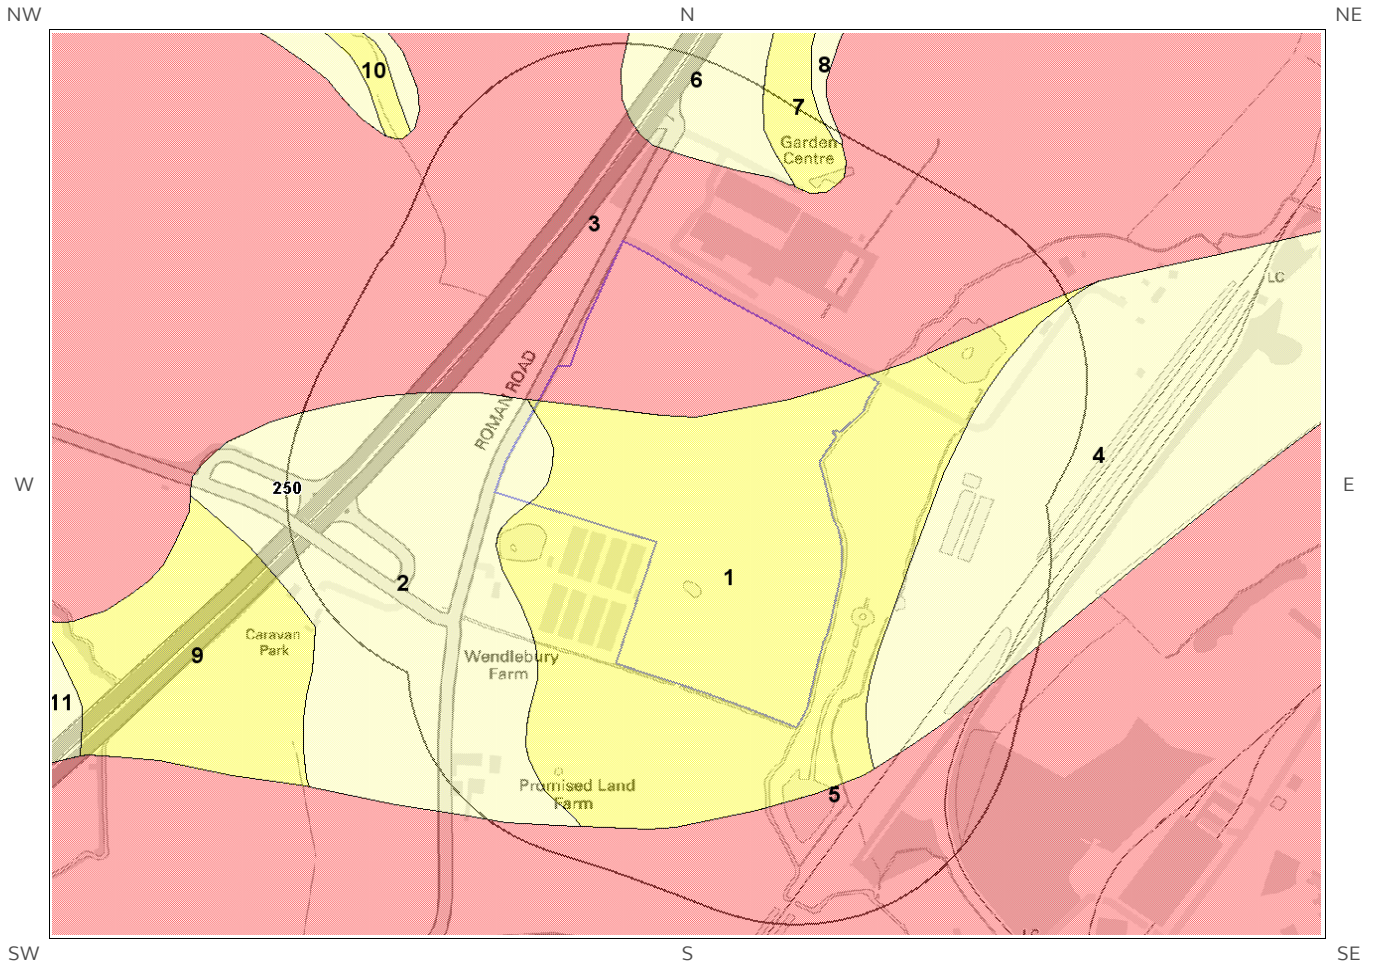


Shrink Swell Clay Legend

© Crown copyright and database rights 2018.
Ordnance Survey license 100035207.



6.2 Landslides map

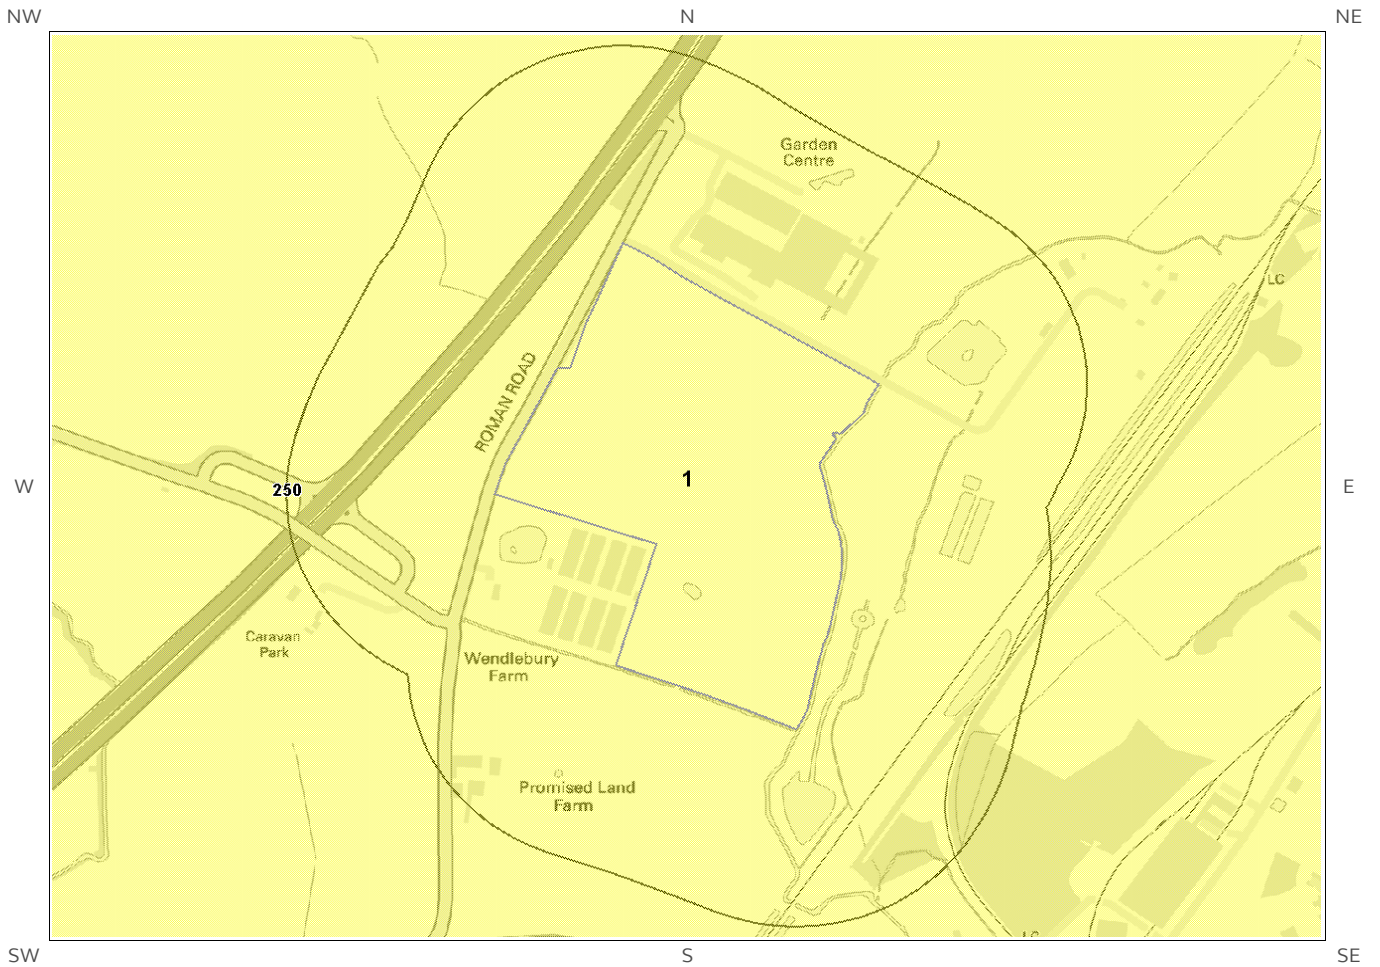


Landslides Legend

© Crown copyright and database rights 2018.
Ordnance Survey license 100035207.



6.3 Ground Dissolution of Soluble Rocks map

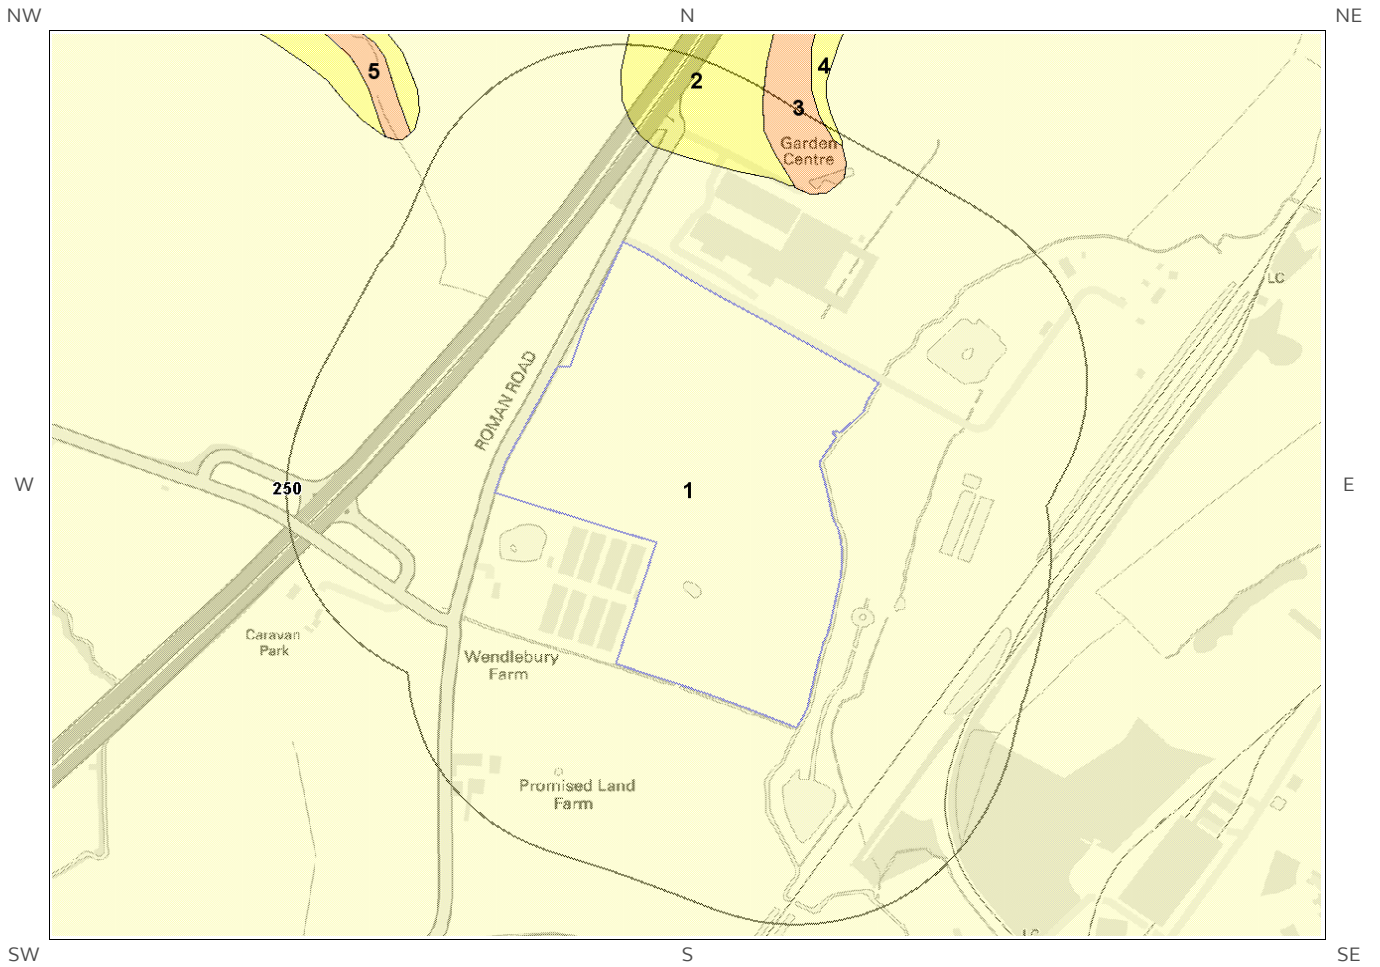


Ground Dissolution Soluble Rocks Legend

© Crown copyright and database rights 2018.
Ordnance Survey license 100035207.



6.4 Compressible Deposits map

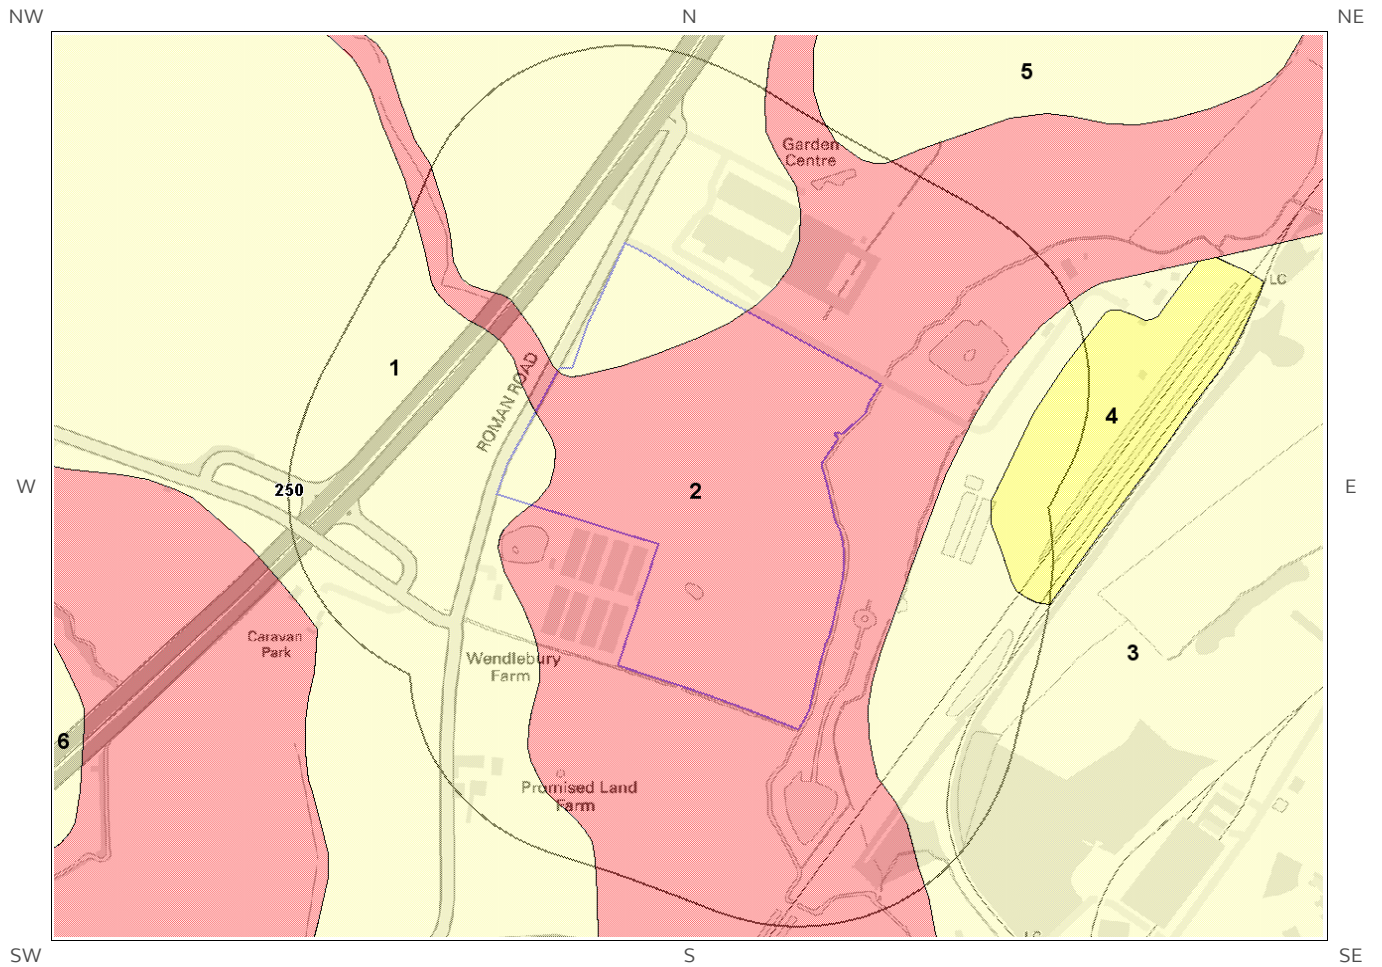


Compressible Deposits Legend

© Crown copyright and database rights 2018.
Ordnance Survey license 100035207.



6.5 Collapsible Deposits map

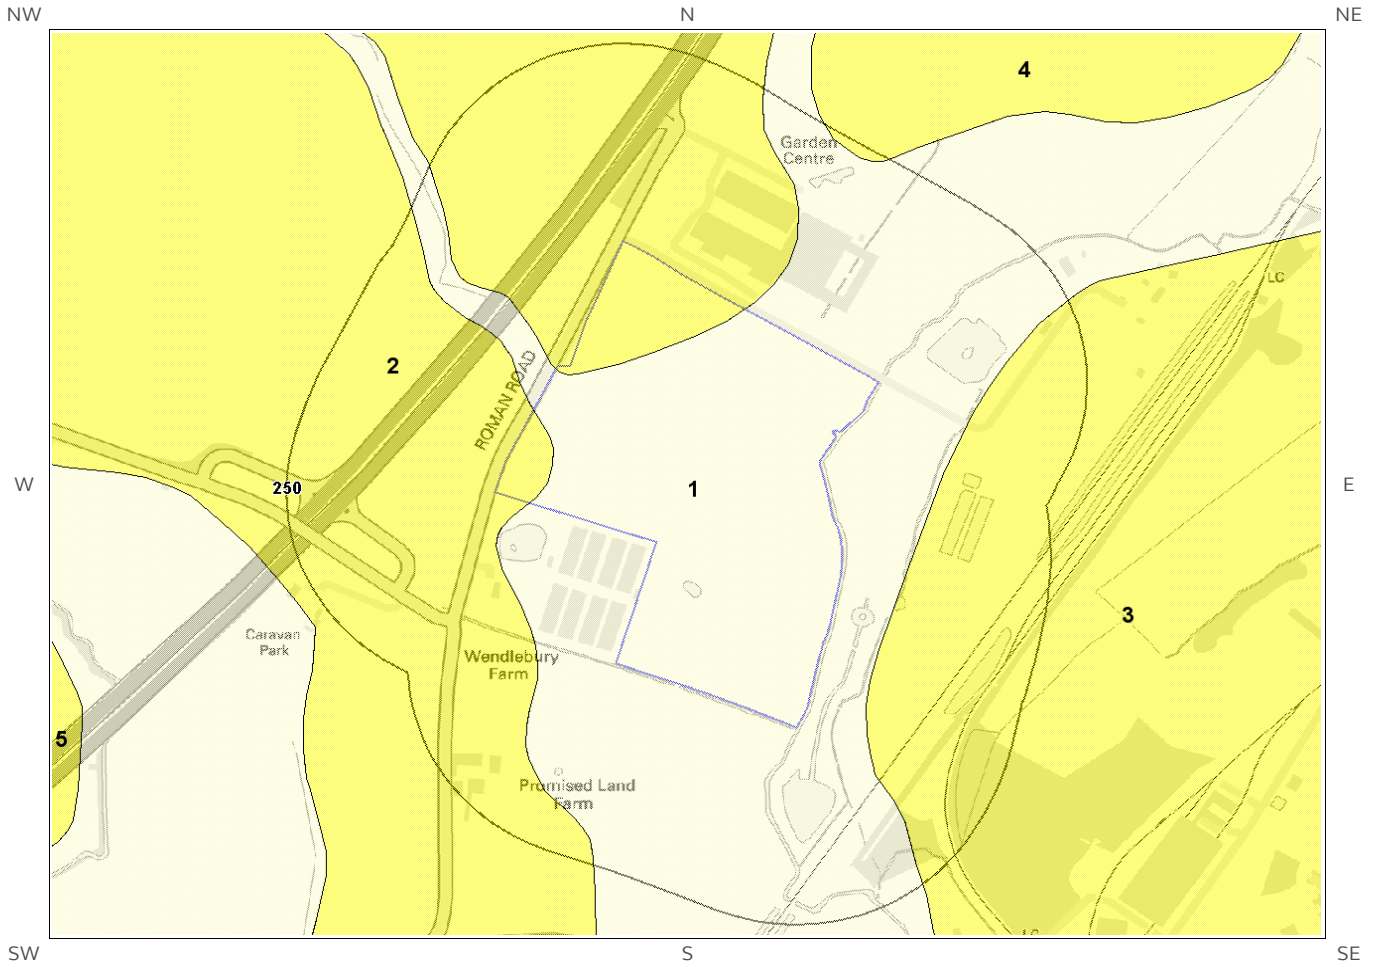


Collapsible Deposits Legend

© Crown copyright and database rights 2018.
Ordnance Survey license 100035207.



6.6 Running Sand map

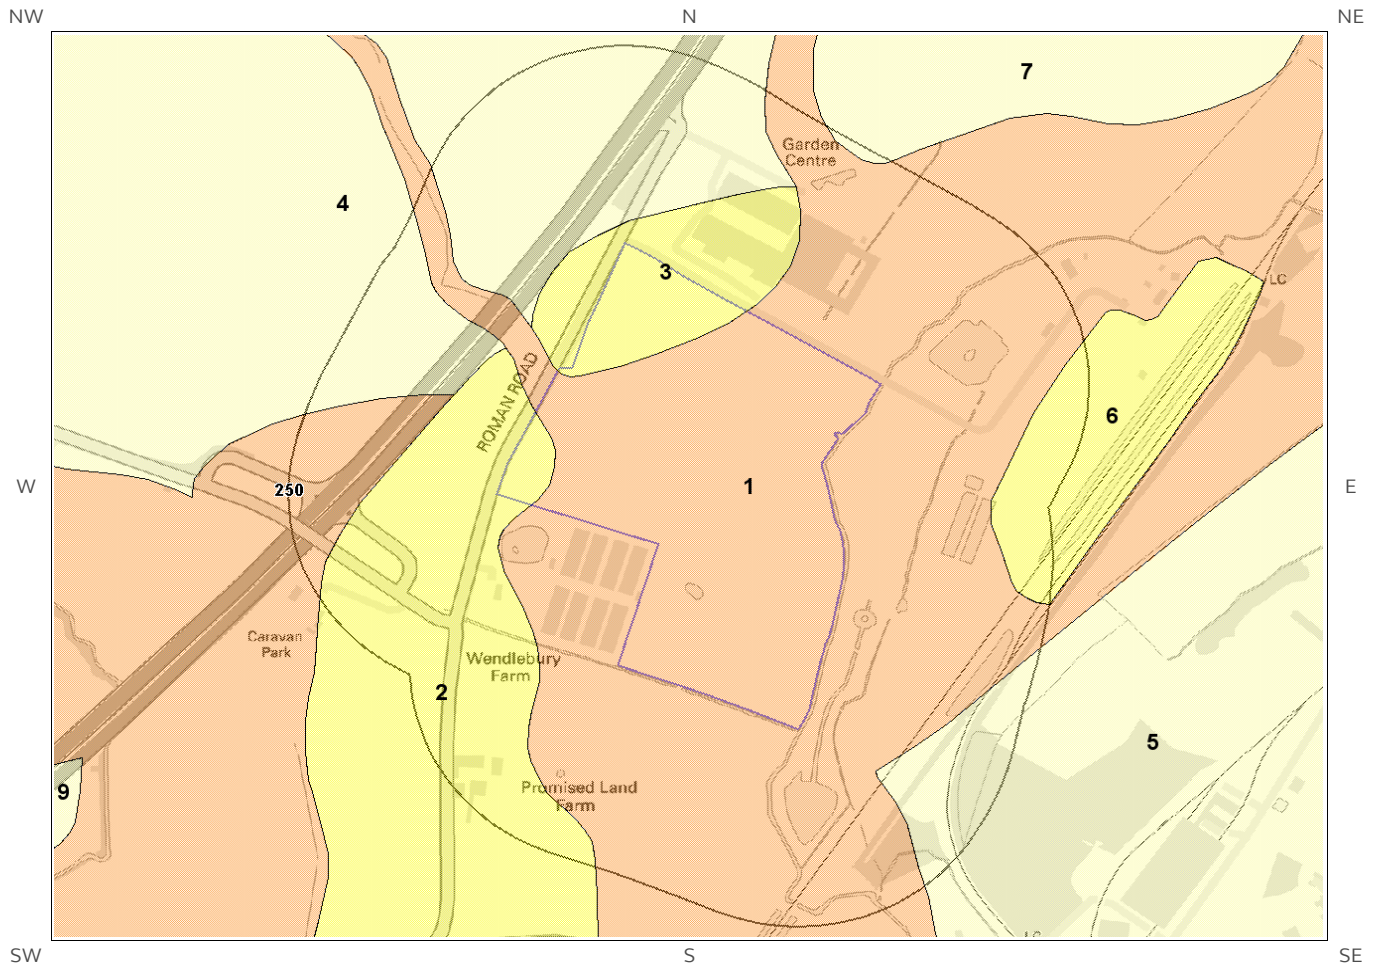

Running Sand Legend

© Crown copyright and database rights 2018.
Ordnance Survey license 100035207.



6 Natural Ground Subsidence

The National Ground Subsidence rating is obtained through the 6 natural ground stability hazard datasets, which are supplied by the British Geological Survey (BGS).

The following GeoSure data represented on the mapping is derived from the BGS Digital Geological map of Great Britain at 1:50,000 scale.

What is the maximum hazard rating of natural subsidence within the study site** boundary? Moderate

6.1 Shrink-Swell Clays

The following Shrink Swell information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Very Low	Ground conditions predominantly low plasticity. No special actions required to avoid problems due to shrink-swell clays. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with shrink-swell clays.
2	0.0	On Site	Negligible	Ground conditions predominantly non-plastic. No special actions required to avoid problems due to shrink-swell clays. No special ground investigation required, and increased construction costs or increased financial risks are unlikely likely due to potential problems with shrink-swell clays.
3	0.0	On Site	Moderate	Ground conditions predominantly high plasticity. Do not plant or remove trees or shrubs near to buildings without expert advice about their effect and management. For new build, consideration should be given to advice published by the National House Building Council (NHBC) and the Building Research Establishment (BRE). There is a probable increase in construction cost to reduce potential shrink-swell problems. For existing property, there is a probable increase in insurance risk during droughts or where vegetation with high moisture demands is present.

* This includes an automatically generated 50m buffer zone around the site

The following Landslides information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Very Low	Slope instability problems are unlikely to be present. No special actions required to avoid problems due to landslides. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with landslides.

6.3 Ground Dissolution of Soluble Rocks

The following Ground Dissolution information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Negligible	Soluble rocks are present, but unlikely to cause problems except under exceptional conditions. No special actions required to avoid problems due to soluble rocks. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with soluble rocks.

6.4 Compressible Deposits

The following Compressible Deposits information provided by the British Geological Survey:

ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Negligible	No indicators for compressible deposits identified. No special actions required to avoid problems due to compressible deposits. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with compressible deposits.
2	0.0	On Site	Moderate	Significant potential for compressibility problems. Avoid large differential loadings of ground. Do not drain or de-water ground near the property without technical advice. For new build - consider possibility of compressible ground in ground investigation, construction and building design. Consider effects of groundwater changes. Extra construction costs are likely. For existing property - possible increase in insurance risk from compressibility, especially if water conditions or loading of the ground change significantly.

The following Collapsible Rocks information provided by the British Geological Survey:


ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Negligible	No indicators for collapsible deposits identified. No actions required to avoid problems due to collapsible deposits. No special ground investigation required, or increased construction costs or increased financial risk due to potential problems with collapsible deposits.
2	0.0	On Site	Very Low	Deposits with potential to collapse when loaded and saturated are unlikely to be present. No special ground investigation required or increased construction costs or increased financial risk due to potential problems with collapsible deposits.

6.6 Running Sands

The following Running Sands information provided by the British Geological Survey:


ID	Distance (m)	Direction	Hazard Rating	Details
1	0.0	On Site	Low	Possibility of running sand problems after major changes in ground conditions. Normal maintenance to avoid leakage of water-bearing services or water bodies (ponds, swimming pools) should reduce likelihood of problems due to running sand. For new build - consider possibility of running sand into trenches or excavations if water table is high or sandy strata are exposed to water. Avoid concentrated water inputs to site. Unlikely to be an increase in construction costs due to potential for running sand. For existing property - no significant increase in insurance risk due to running sand problems is likely.
2	0.0	On Site	Very Low	Very low potential for running sand problems if water table rises or if sandy strata are exposed to water. No special actions required, to avoid problems due to running sand. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with running sand.
3	0.0	On Site	Very Low	Very low potential for running sand problems if water table rises or if sandy strata are exposed to water. No special actions required, to avoid problems due to running sand. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with running sand.
4	24.0	NW	Negligible	No indicators for running sand identified. No special actions required to avoid problems due to running sand. No special ground investigation required, and increased construction costs or increased financial risks are unlikely due to potential problems with running sand.

7 Borehole Records map

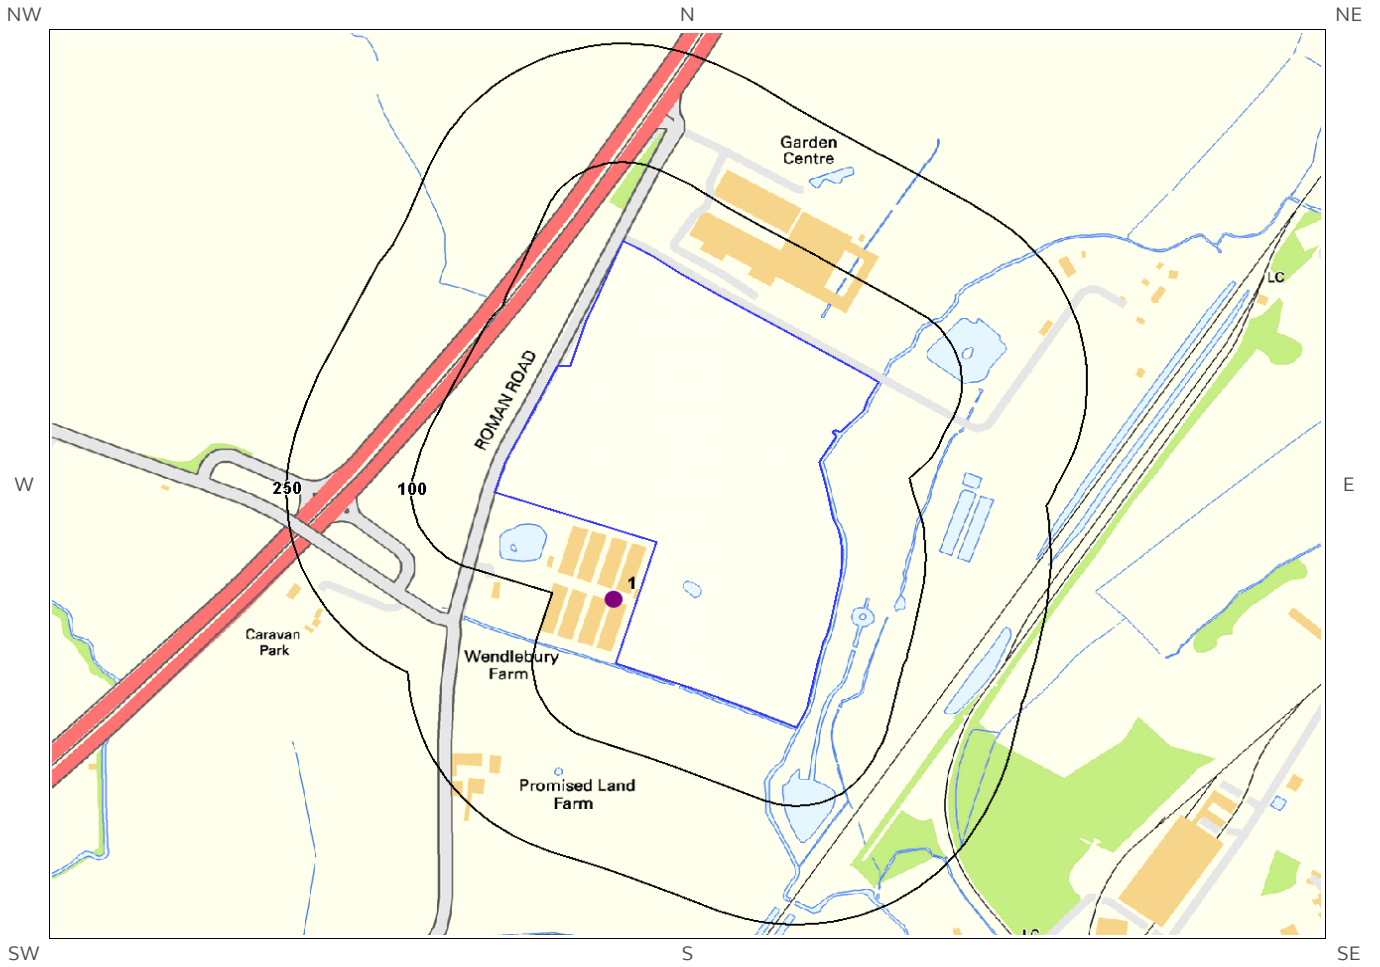

Borehole Records Legend

© Crown copyright and database rights 2018.
Ordnance Survey license 100035207.

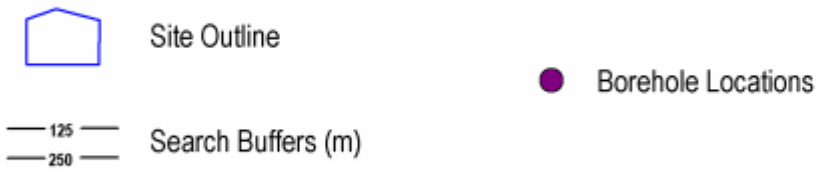

7 Borehole Records

The systematic analysis of data extracted from the BGS Borehole Records database provides the following information.

Records of boreholes within 250m of the study site boundary:

1

ID	Distance (m)	Direction	NGR	BGS Reference	Drilled Length	Borehole Name
1	28.0	W	457450 220860	SP52SE28	15.0	PROMISED LAND FARM BICESTER OXON

The borehole records are available using the hyperlinks below: Please note that if the donor of the borehole record has requested the information be held as commercial-in-confidence, the additional data will be held separately by the BGS and a formal request must be made for its release.

#1: scans.bgs.ac.uk/sobi_scans/boreholes/336728

8 Estimated Background Soil Chemistry

Records of background estimated soil chemistry within 250m of the study site boundary:


15

For further information on how this data is calculated and limitations upon its use, please see the Groundsure Geo Insight User Guide, available on request.

Distance (m)	Direction	Sample Type	Arsenic (As)	Cadmium (Cd)	Chromium (Cr)	Nickel (Ni)	Lead (Pb)
0.0	On Site	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	30 - 45 mg/kg	<100 mg/kg
0.0	On Site	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	90 - 120 mg/kg	30 - 45 mg/kg	<100 mg/kg
0.0	On Site	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	30 - 45 mg/kg	<100 mg/kg
0.0	On Site	RuralSoil	<15 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg
0.0	On Site	RuralSoil	<15 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg
0.0	On Site	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	90 - 120 mg/kg	30 - 45 mg/kg	<100 mg/kg
0.0	On Site	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg
0.0	On Site	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg
0.0	On Site	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	30 - 45 mg/kg	<100 mg/kg
0.0	On Site	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	30 - 45 mg/kg	<100 mg/kg
0.0	On Site	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	30 - 45 mg/kg	<100 mg/kg
0.0	On Site	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	30 - 45 mg/kg	<100 mg/kg
0.0	On Site	RuralSoil	15 - 25 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	30 - 45 mg/kg	<100 mg/kg
12.0	NW	RuralSoil	<15 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg
24.0	NW	RuralSoil	<15 mg/kg	<1.8 mg/kg	60 - 90 mg/kg	15 - 30 mg/kg	<100 mg/kg





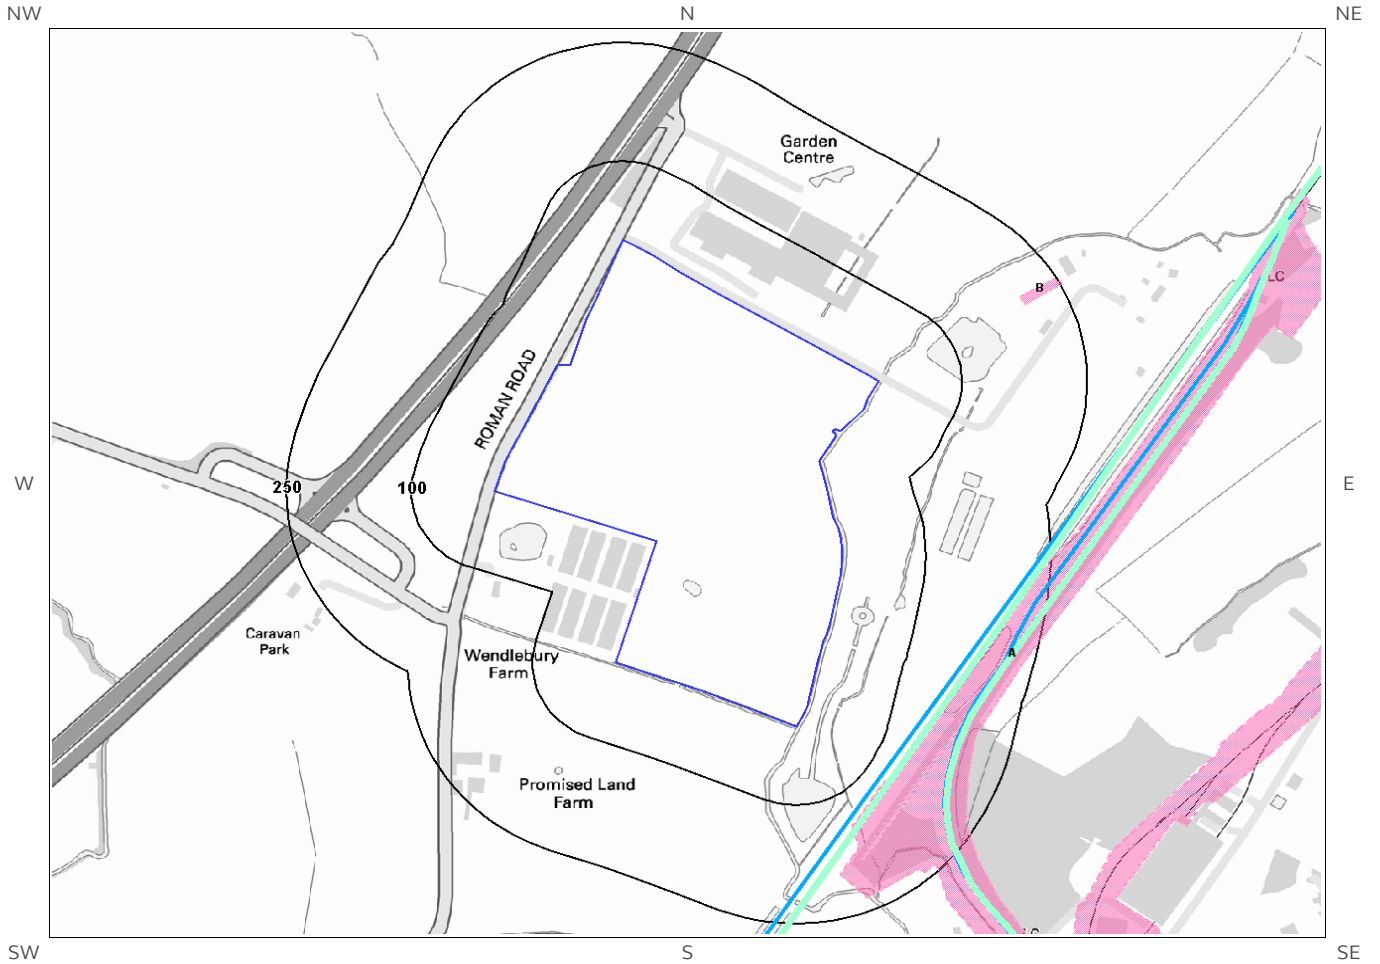








*As this data is based upon underlying 1:50,000 scale geological information, a 50m buffer has been added to the search radius.

9 Railways and Tunnels map



Railways and Tunnels Legend

© Crown copyright and database rights 2018.
Ordnance Survey license 100035207.
© OpenStreetMapContributors

- | | | | | | |
|---|-----------------------------|---|--|---|---|
|  | Site Outline |  | Underground or Partially Underground Railway / Subway System |  | Railway Track (OpenStreetMap) |
|  | Railway Tunnel (OS Mapping) |  | High Speed 2 |  | High Speed 2 Revised Proposed Route |
|  | Search Buffers (m) |  | Abandoned or Dismantled Railway (OpenStreetMap) |  | Crossrail 1 |
|  | 250 |  | Railway Track (OS Mapping) |  | Railway and/or Tunnel Feature from Historical Mapping |
|  | 500 | | | | |

9 Railways and Tunnels

9.1 Tunnels

This data is derived from OpenStreetMap and provides information on the possible locations of underground railway systems in the UK - the London Underground, the Tyne & Wear Metro and the Glasgow Subway.

Have any underground railway lines been identified within the study site boundary? No

Have any underground railway lines been identified within 250m of the study site boundary? No

Database searched and no data found.

Any records that have been identified are represented on the Railways and Tunnels map.

This data is derived from Ordnance Survey mapping and provides information on the possible locations of railway tunnels forming part of the UK overground railway network.

Have any other railway tunnels been identified within the site boundary? No

Have any other railway tunnels been identified within 250m of the site boundary? No

Database searched and no data found.

Any records that have been identified are represented on the Railways and Tunnels map.

9.2 Historical Railway and Tunnel Features

This data is derived from Groundsure's unique Historical Land-use Database and contains features relating to tunnels, railway tracks or associated works that have been identified from historical Ordnance Survey mapping.

Have any historical railway or tunnel features been identified within the study site boundary? No

Have any historical railway or tunnel features been identified within 250m of the study site boundary? Yes

ID	Distance (m)	Direction	NGR	Details	Date
1A	127	SE	457851 220688	Railway Sidings	1985
2A	127	SE	457851 220688	Railway Sidings	1966
3A	127	SE	457851 220688	Railway Sidings	1970
4A	127	SE	457851 220688	Railway Sidings	1995
5	158	SE	457882 220729	Railway Sidings	1966
6B	200	NE	457963 221249	Railway Sidings	1995

ID	Distance (m)	Direction	NGR	Details	Date
7B	200	NE	457963 221249	Railway Sidings	1995

Any records that have been identified are represented on the Railways and Tunnels map.

9.3 Historical Railways

This data is derived from OpenStreetMap and provides information on the possible alignments of abandoned or dismantled railway lines in proximity to the study site.

Have any historical railway lines been identified within the study site boundary? No

Have any historical railway lines been identified within 250m of the study site boundary? No

Database searched and no data found.

Multiple sections of the same track may be listed in the detail above

Any records that have been identified are represented on the Railways and Tunnels map.

9.4 Active Railways

These datasets are derived from Ordnance Survey mapping and OpenStreetMap and provide information on the possible locations of active railway lines in proximity to the study site.

Have any active railway lines been identified within the study site boundary? No

Have any active railway lines been identified within 250m of the study site boundary? Yes

Distance (m)	Direction	Name	Type
120	SE	Not given	Multi Track
120	SE	Not given	Multi Track
132	SE	Not given	Rail
132	SE	Not given	Rail
185	E	Not given	Multi Track
185	E	Not given	Multi Track
188	E	Bicester Military Railway	Rail
188	E	Bicester Military Railway	Rail
214	E	Not given	Multi Track
214	E	Not given	Multi Track
214	E	Not given	Multi Track
214	E	Not given	Multi Track

Multiple sections of the same track may be listed in the detail above

Any records that have been identified are represented on the Railways and Tunnels map.

These datasets provide information on the location of large scale railway projects High Speed 2 and Crossrail 1 .

Is the study site within 5km of the route of the High Speed 2 rail project? No

Is the study site within 500m of the route of the Crossrail 1 rail project? No

*Further information on proximity to these routes, the project construction status and associated works can be obtained through the purchase of a **Groundsure HS2 and Crossrail 1 Report**.*

The route data has been digitised from publicly available maps by Groundsure. The route as provided relates to the Crossrail 1 project only, and does not include any details of the Crossrail 2 project, as final details of the route for Crossrail 2 are still under consultation.

Please note that this assessment takes account of both the original Phase 2b proposed route and the amended route proposed in 2016. As the Phase 2b route is still under consultation, Groundsure are providing information on both options until the final route is formally confirmed. Practitioners should take account of this uncertainty when advising clients.

Contact Details

emapsite
Telephone: 0118 9736883
sales@emapsite.com



British Geological Survey Enquiries

Kingsley Dunham Centre
Keyworth, Nottingham NG12 5GG
Tel: 0115 936 3143.
Fax: 0115 936 3276.
Email: enquiries@bgs.ac.uk
Web: www.bgs.ac.uk

BGS Geological Hazards Reports and general geological enquiries



British Geological Survey
NATURAL ENVIRONMENT RESEARCH COUNCIL

British Gypsum

British Gypsum Ltd
East Leake
Loughborough
Leicestershire
LE12 6HX



The Coal Authority

200 Lichfield Lane
Mansfield
Notts NG18 4RG
Tel: 0345 7626 848
DX 716176 Mansfield 5
www.coal.gov.uk



The Coal Authority

Public Health England

Public information access office
Public Health England, Wellington House
133-155 Waterloo Road, London, SE1 8UG
<https://www.gov.uk/government/organisations/public-health-england>
Email: enquiries@phe.gov.uk
Main switchboard: 020 7654 8000



Public Health England

Johnson Poole & Bloomer Limited

Harris and Pearson Building, Brettel Lane
Brierley Hill, West Midlands
DY5 3LH
Tel: +44 (0) 1384 262 000
Email: enquiries.gs@jpb.co.uk
Website: www.jpb.co.uk



Ordnance Survey

Adanac Drive, Southampton
SO16 0AS
Tel: 08456 050505
Website: <http://www.ordnancesurvey.co.uk/>



Getmapping PLC

Virginia Villas, High Street, Hartley Witney,
Hampshire RG27 8NW
Tel: 01252 845444
Website: <http://www.1.getmapping.com/>



Peter Brett Associates
Caversham Bridge House
Waterman Place
Reading
Berkshire RG1 8DN
Tel: +44 (0)118 950 0761 E-mail: reading@pba.co.uk
Website: <http://www.peterbrett.com/home>



Acknowledgements: Ordnance Survey © Crown Copyright and/or Database Right. All Rights Reserved. Licence Number [03421028]. This report has been prepared in accordance with the Groundsure Ltd standard Terms and Conditions of business for work of this nature.

Standard Terms and Conditions

Groundsure's Terms and Conditions can be viewed online at this link:
<https://www.groundsure.com/terms-and-conditions-may25-2018>



EmapSite

Masdar House, 1 Reading Road,
Eversley, RG27 0RP

Groundsure Reference: EMS-482678_647815

Your Reference: EMS_482678_647815

Report Date 7 Jun 2018

Report Delivery Method: Email - pdf

Enviro Insight

Address: The Promised Land Farm, Wendlebury Road, Bicester,

Dear Sir/ Madam,

Thank you for placing your order with Groundsure. Please find enclosed the **Groundsure Enviro Insight** as requested.

If you would like further assistance regarding this report then please contact the emapsite customer services team on 0118 9736883 quoting the above report reference number.

Yours faithfully,

emapsite customer services team

Enc.
Groundsure Enviroinsight

Address: The Promised Land Farm, Wendlebury Road, Bicester,
Date: 7 Jun 2018
Reference: EMS-482678_647815
Client: EmapSite



Aerial Photograph Capture date: 06-Sep-2015
Grid Reference: 457556,221013
Site Size: 15.35ha

Report Reference: EMS-482678_647815
Client Reference: EMS_482678_647815

Contents Page

Contents Page	3
Overview of Findings	6
Using this report	10
1. Historical Land Use	11
1. Historical Industrial Sites	12
1.1 Potentially Contaminative Uses identified from 1:10,000 scale Mapping	12
1.2 Additional Information – Historical Tank Database	13
1.3 Additional Information – Historical Energy Features Database	15
1.4 Additional Information – Historical Petrol and Fuel Site Database	15
1.5 Additional Information – Historical Garage and Motor Vehicle Repair Database	15
1.6 Potentially Infilled Land	15
2. Environmental Permits, Incidents and Registers Map	17
2. Environmental Permits, Incidents and Registers	18
2.1 Industrial Sites Holding Licences and/or Authorisations	18
2.1.1 Records of historic IPC Authorisations within 500m of the study site	18
2.1.2 Records of Part A(1) and IPPC Authorised Activities within 500m of the study site	18
2.1.3 Records of Red List Discharge Consents (potentially harmful discharges to controlled waters) within 500m of the study site	20
2.1.4 Records of List 1 Dangerous Substances Inventory Sites within 500m of the study site	20
2.1.5 Records of List 2 Dangerous Substance Inventory Sites within 500m of the study site	20
2.1.6 Records of Part A(2) and Part B Activities and Enforcements within 500m of the study site	20
2.1.7 Records of Category 3 or 4 Radioactive Substances Authorisations	20
2.1.8 Records of Licensed Discharge Consents within 500m of the study site	21
2.1.9 Records of Water Industry Referrals (potentially harmful discharges to the public sewer) within 500m of the study site	23
2.1.10 Records of Planning Hazardous Substance Consents and Enforcements within 500m of the study site	23
2.2 Dangerous or Hazardous Sites	23
2.3 Environment Agency/Natural Resources Wales Recorded Pollution Incidents	23
2.3.1 Records of National Incidents Recording System, List 2 within 500m of the study site	23
2.3.2 Records of National Incidents Recording System, List 1 within 500m of the study site	24
2.4 Sites Determined as Contaminated Land under Part 2A EPA 1990	24
3. Landfill and Other Waste Sites Map	25
3. Landfill and Other Waste Sites	26
3.1 Landfill Sites	26
3.1.1 Records from Environment Agency/Natural Resources Wales landfill data within 1000m of the study site	26
3.1.2 Records of Environment Agency/Natural Resources Wales historic landfill sites within 1500m of the study site	26
3.1.3 Records of BGS/DoE non-operational landfill sites within 1500m of the study site	26
3.1.4 Records of Landfills from Local Authority and Historical Mapping Records within 1500m of the study site	26
3.2 Other Waste Sites	27
3.2.1 Records of waste treatment, transfer or disposal sites within 500m of the study site	27
3.2.2 Records of Environment Agency/Natural Resources Wales licensed waste sites within 1500m of the study site	27
4. Current Land Use Map	28
4. Current Land Uses	29
4.1 Current Industrial Data	29
4.2 Petrol and Fuel Sites	29
4.3 National Grid High Voltage Underground Electricity Transmission Cables	29
4.4 National Grid High Pressure Gas Transmission Pipelines	30



5. Geology	31
5.1 Artificial Ground and Made Ground.....	31
5.2 Superficial Ground and Drift Geology	31
5.3 Bedrock and Solid Geology	31
6 Hydrogeology and Hydrology	32
6a. Aquifer Within Superficial Geology	32
6b. Aquifer Within Bedrock Geology and Abstraction Licences	33
6c. Hydrogeology – Source Protection Zones and Potable Water Abstraction Licences	34
6d. Hydrogeology – Source Protection Zones within confined aquifer	35
6e. Hydrology – Watercourse Network and River Quality	36
6.Hydrogeology and Hydrology	37
6.1 Aquifer within Superficial Deposits.....	37
6.2 Aquifer within Bedrock Deposits.....	37
6.3 Groundwater Abstraction Licences.....	38
6.4 Surface Water Abstraction Licences.....	39
6.5 Potable Water Abstraction Licences.....	39
6.6 Source Protection Zones.....	40
6.7 Source Protection Zones within Confined Aquifer.....	40
6.8 Groundwater Vulnerability and Soil Leaching Potential.....	40
6.9 River Quality.....	40
6.9.1 Biological Quality:.....	41
6.9.2 Chemical Quality:.....	41
6.10 Ordnance Survey MasterMap Water Network.....	41
6.11 Surface Water Features.....	58
7a. Environment Agency/Natural Resources Wales Flood Map for Planning (from rivers and the sea)	59
7b. Environment Agency/Natural Resources Wales Risk of Flooding from Rivers and the Sea (RoFRaS) Map	60
7 Flooding	61
7.1 River and Coastal Zone 2 Flooding.....	61
7.2 River and Coastal Zone 3 Flooding.....	61
7.3 Risk of Flooding from Rivers and the Sea (RoFRaS) Flood Rating.....	62
7.4 Flood Defences.....	63
7.5 Areas benefiting from Flood Defences.....	63
7.6 Areas benefiting from Flood Storage.....	63
7.7 Groundwater Flooding Susceptibility Areas.....	63
7.8 Groundwater Flooding Confidence Areas.....	64
8. Designated Environmentally Sensitive Sites Map	65
8. Designated Environmentally Sensitive Sites	66
8.1 Records of Sites of Special Scientific Interest (SSSI) within 2000m of the study site:.....	66
8.2 Records of National Nature Reserves (NNR) within 2000m of the study site:.....	66
8.3 Records of Special Areas of Conservation (SAC) within 2000m of the study site:.....	66
8.4 Records of Special Protection Areas (SPA) within 2000m of the study site:.....	66
8.5 Records of Ramsar sites within 2000m of the study site:.....	66
8.6 Records of Ancient Woodland within 2000m of the study site:	67
8.7 Records of Local Nature Reserves (LNR) within 2000m of the study site:.....	67
8.8 Records of World Heritage Sites within 2000m of the study site:.....	67
8.9 Records of Environmentally Sensitive Areas within 2000m of the study site:	67
8.10 Records of Areas of Outstanding Natural Beauty (AONB) within 2000m of the study site:	67
8.11 Records of National Parks (NP) within 2000m of the study site:	68
8.12 Records of Nitrate Sensitive Areas within 2000m of the study site:.....	68
8.13 Records of Nitrate Vulnerable Zones within 2000m of the study site:.....	68